

ALLEGAN COUNTY REMONUMENTATION
 LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

ALLEGAN
(County)

Located in:

Corner Code ##

1. Public Land Survey	T <u>1N</u> R <u>14W</u>	<u>M-2</u>
	T _____ R _____	<u>Cheshire Twp.</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

1995 DEC 14 PM 2:32
 J. J. ...
 REGISTER OF DEEDS

FILED

Register of Deeds Stamp & File Number

**SURVEY &
 REMONUMENTATION**

APR 29 1996

COMMISSION

A	B	C	D	E	F	G	H	I	J	K	L
2	6	5	4	3	2	1					
3											
4	7	8	9	10	11	12					
5											
6	18	17	16	15	14	13					
7											
8	19	20	21	22	23	24					
9											
10	30	29	28	27	26	25					
11											
12	31	32	33	34	35	36					
13											

I, Donald R. Pitts, Jr. in a field survey on April 1, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. Set $\frac{1}{4}$ Section Post
 Tamarack 6 Inches S.78°W. 5 Links
 Tamarack 8 Inches N.48°W. 3 Links

APPROVED REMONUMENTATION CORNER
 P.A. 345 OF 1990
 ALLEGAN COUNTY


DATE APPROVED 4-12-94
 COUNTY REP. [Signature]

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No Physical Monument found and no previous History
 Set Standard Allegan Co. Remon. 3/4" X 36" Iron with Red Cap #23520 on Range line prorated distance from M-3 to M-1, T.1N., R.14W.
 Approved by Allegan Co. Remon. Peer Group on April 12, 1994, and is Accepted as a careful and faithful reestablishment of the position of the original corner.
 Traversed off road 5074'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Standard Allegan Co. Remon. 3/4" X 36" Iron w/Red Cap #23520 on West edge of drain.
 A-2, T.1N., R.13W. Standard Allegan Co. Remon 3/4" X 36" Iron with Red Cap #23520 North 42.24'
 Nail & Allegan Co. Remon Tag S. Side 5" Hackberry N.70°W. 19.54'
 " " " " " N.'ly Side 5" Hackberry S.65°W. 20.88'
 " " " " " N.'ly Side 12" Poplar N.80°W. 37.94'
 " " " " " S.'ly Side 20" Maple S.80°W. 68.92'

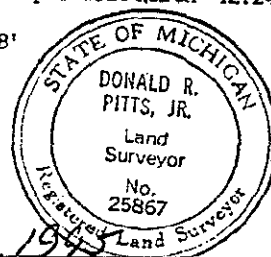

Signed by Donald R. Pitts, Jr.
 Surveyor's Michigan License No. 25867

Date APRIL 18, 1995