
_		
S	8	
graster a	FEB - I	
	-	
3/3/ 3/3/4	ĆĊ)
	,	

	111-111	0 1 ZU	JU	ALLE	GAN COUNTY REMOI	NUMENTATION				
	SEC	MOIT	Ł	.AND C	ORNER RECORDATION	ON CERTIFICATE	ARROX	60		
For	corners in			Fil	ing Requirement of Act 74, 8	Alch. P.A. 1970	REGISTER OF ALLEGAN CON	FEB -	<u> </u>	
AL	LEGAN COUNTY	••••••	Located		Corner Code #		Al Malanda			raut.j
1.	Public Land Survey	7			/G-8			ĆĆ	0	7
2.	Property Controlling in Section		T	R			i i i i i i i i i i i i i i i i i i i)		
3.	Miscellaneous Property in Sec.	S	T	R	***************************************	Registe	r of Deeds Sta	mp & File N	umber	
4.		Recorded	Plat		••••••••••••••••••••••••••••••	<u> </u>				

I, George J. Mitchell....., in a field survey on ... October 5, 1999..... do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3. 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

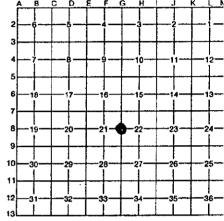

47.1

- A. Description of original monument and accessories and/or subsequent restoration:
- 1. C. BRITAIN D.S. 1831 - SET POST AT 40.00 CHAINS - PINE 30 S42W, 16 LKS & BEECH 12N45E, 20 LKS
- 2 OLD NOTES (NO DATE) IRON - OAK SE 29.5' & 2614' EAST TO CENTER
- 3. D. RATEKIN P.S. 1971 -L.C.R.C. L002, P028 - FOUND 1* IRON - STREET SIGN S45E 47.6' & T.C.B. S45W
- NE COR. HOUSE S60W 91.2' & 16" TW. CHERRY N30E 73.4' 4. D. RATEKIN P.S. 1975 SAME AS L.C.R.C. ABOVE
- 5. J. DILLINGHAM P.S. 1980 FOUND 1" IRON - SAME WITNESSES AS ABOVE
- 6. G. MITCHELL P.S. 1986
- FOUND 1" IRON SAME WITNESSES AS ABOVE MEASURED 2615.22" EAST TO CENTER B. ANDRESS P.S. 1993 115.21' & 34" PINE S22E 112.95" FOUND 1" IRON - 24" PINE N39E
- 20" TW. PINE \$37W 55.59' & 27" PINE N45W 61.07' & MEAS 2615.05' EAST TO CENTER
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1" IRON BAR FROM ITEMS 3, 6, AND 7 OF CORNER HISTORY, AND IS ACCEPTED AS A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION OF THE ORIGINAL CORNER.

SET ALLEGAN COUNTY STANDARD 3/4" BY 24" IRON PIN WITH REMON CAP IN MON BOX

THIS CORNER WAS APPROVED BY THE ALLEGAN COUNTY SURVEYORS PEER GROUP ON JUNE 8, 1999

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

WEST QUARTER POST OF SECTION 22, TOWN 1 NORTH, RANGE 15 WEST

A.C. REMON TAG & NAIL IN SOUTHEAST SIDE OF 24" PINE A.C. REMON TAG & NAIL IN NORTHWEST SIDE OF 20" TW PINE A.C. REMON TAG & NAIL IN NORTHEAST SIDE OF 27" PINE A.C. REMON TAG & NAIL IN SOUTHEAST SIDE OF 30" PINE CENTER OF EAST-WEST ASPHALT ROAD CORNER LINES UP WITH CENTER OF ROAD TO NORTH	NORTH	AZ. AZ. AZ. AZ.	039° 215° 325° 080° 5′	115.21 FEET 55.60 FEET 61.17 FEET 112.78 FEET
--	-------	--------------------------	------------------------------------	--

APPROVED REMONUMENTATION CORNER P.A. 345 OF 1990 ALLEGAN COUNTY

DATE APPROVED

COUNTY REP.

Surveyor's Michigan License No.19618.....

