

# SURVEY & REMONUMENTATION

APR 25 1995

## COMMISSION

For corners in

### ALLEGAN COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

ALLEGAN (County)	Located In:	Corner Code #
1. Public Land Survey	T-1N R-15W	J-10 (CEN 26)
	T R	LEE TWP.
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

REGISTER OF DEEDS  
 ALLEGAN COUNTY, MICHIGAN  
 1994 DEC 16 AM 9:56  
 REGISTER OF DEEDS STAMP & FILE NUMBER  
 FILED

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

1. BASIL ADDRESS in a field survey on 17 NOV 1994 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessions and/or subsequent restoration:  
 NOT SET BY G.L.O.

OLD NOTES-COUNTY SURVEYOR  
 -SHOWS IRON  
 -WHITEWOOD 10" N 39'  
 -ASH 3" NW 24.9'  
 DIST. W TO W 1/4 COR 2637.4'  
 DIST. E TO 1/8 POST 1318.7'  
 DIST. CONT. E TO E 1/4 COR (IN LAKE) 1318.7'

APPROVED REMONUMENTATION CORNER  
 P.A. 345 OF 1990  
 ALLEGAN COUNTY  
 DATE APPROVED 7-12-94  
 COUNTY REP. Basil J. Address


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FD. 1" PIPE  
 -CHECKED W/ WITNESSES FROM MITCHELL SURVEYS, INC.  
 -N 89DEG-56'-40" W 2635.53' TO W 1/4 COR.  
 -N 00DEG-29'-49" W 2640.13' TO N 1/4 COR.  
 -N 90DEG-00'-00" E 2190.18' TO REF. MON. (E 1/4 COR IS IN LAKE)

THIS POSITION NOT ESTABLISHED BY ORIGINAL GOVERNMENT SURVEYORS. THIS MONUMENT IS ACCEPTED AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE CORNER.

C. Description of monument for corner and accessions established to perpetuate locating the position of the corner:

REPLACED 1" PIPE W/ STD. ALLEGAN CO. MON. (3/4" X 24" PIN & CAP)  
 16d & REMON TAG E SDE 14" POPLAR SOUTH 35.78'  
 16d & REMON TAG NW SDE 10" W. CHERRY S 45 W 70.35'  
 16d & REMON TAG SW SDE QUAD OAK 4"-18"-18"-20" N 50 W 54.62'  
 16d & REMON TAG E SDE 10" SASSAFRAS NORTH 36.75'  
 16d & REMON TAG S SDE 12" MAPLE N 80 E 189.25'  
 C/L 103rd AVE NORTH 3.0'

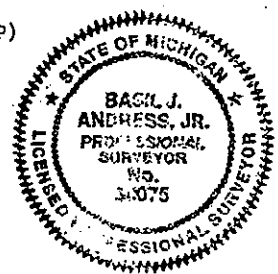

Signed by Basil J. Address Date 12 DEC 94  
 Surveyor's Michigan License No. 30075

USEP 0005 PAGE 061

*Allegan*

\*CONT. FROM FRONT OF CERTIFICATE\*

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

OLD NOTES-COUNTY SURVEYOR  
DIST. N TO N 1/4 COR 2637.5'

DONALD A. RATEKIN, C.S.  
DIST. W TO W 1/4 COR 2636.0'  
DIST. N TO N 1/4 COR 2638.8'  
ANGLE W TO N 89DEG-26'  
ESTABLISHED 1/4 DIRECTOR-SOUTH BY EXTENDING LINE FROM N 1/4 COR THROUGH  
CENTER (SOUTH 1/4 COR IS IN LAKE)

MITCHELL SURVEYS, INC.  
1" PIPE  
16" TRIPLE OAK - NW 54.43'  
100" OAKS SOUTH 3535171'  
SE COR HSE NE 95.0'  
C/L RD NORTH 3.0'

1" PIPE  
SE COR HSE 95.0'

RECORDED  
INDEXED  
MAY 19 1962

