

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in  
ALLEGAN

(County)	Located In:	Corner Code #
1. Public Land Survey	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S <u>1</u> T <u>1N</u> R <u>15W</u>	<u>13</u>
	S <u>1</u> T <u>1N</u> R <u>15W</u>	<u>14</u>
3. Miscellaneous Property in Sec.	S <u>1</u> T <u>1N</u> R <u>15W</u>	<u>8</u>
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, GARY C. BILOW, in a field survey on April 10, 1991, 19\_\_\_\_\_, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

- (13) CORNER NOT ESTABLISHED IN ORIGINAL SURVEY. FOUND NO SUBSEQUENT RECORD.
- (14) CORNER NOT ESTABLISHED IN ORIGINAL SURVEY. FOUND NO SUBSEQUENT RECORD.
- (8) CORNER NOT ESTABLISHED IN ORIGINAL SURVEY. SHOWN IN PERSONAL RECORD OF FORMER COUNTY SURVEYOR HUGH MacDOUGALL (ca.1900) AS "IRON PIPE, B. OAK NE 31.5', W. OAK NW 31' MIDWAY BETWEEN K-2 AND L-2.


**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

- (13) FOUND NO EVIDENCE OF PRIOR MONUMENTATION. ESTABLISHED CORNER AT THE INTERSECTION OF STRAIGHT LINES CONNECTING CORNERS 9 WITH 16, AND 12 WITH 14. CORNERS 16, 12, AND 14 ARE AS RECORDED THIS DATE. CORNER 9 IS COMPUTED BEING MIDWAY AND ON A STRAIGHT LINE BETWEEN L-2 AND M-2. MONUMENTED CORNER POSITION WITH A 1/2"x36" REBAR ENCASED IN A 4" DIAMETER CONCRETE CYLINDER CAPPED WITH A CAST ALUMINUM MICHIGAN DEPARTMENT OF NATURAL RESOURCES TABLET.
- (14) ESTABLISHED CORNER MIDWAY AND ON A STRAIGHT LINE BETWEEN M-3 AND M-2 AS RECORDED THIS DATE. MONUMENTED THE CORNER POSITION WITH A 1/2"x36" REBAR ENCASED IN A 4" DIAMETER CONCRETE CYLINDER CAPPED WITH A CAST ALUMINUM MICHIGAN DEPARTMENT OF NATURAL RESOURCES TABLET.
- (8) ESTABLISHED CORNER MIDWAY AND ON A STRAIGHT LINE BETWEEN K-2 AND L-2 AS RECORDED THIS DATE AND MONUMENTED CORNER POSITION WITH A 1/2"x36" REBAR ENCASED IN A 4" DIAMETER CONCRETE CYLINDER CAPPED WITH A CAST ALUMINUM MICHIGAN DEPARTMENT OF NATURAL RESOURCES TABLET. FROM THE CORNER MONUMENTED, I FOUND A 3/4" DIAMETER IRON PIPE N29W, 10.98'.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- |  |  |   |
|--|--|---|
| (13) SET CONCRETE MONUMENT WITH MDNR CAP S51W 49.04' SET NAIL AND MDNR TAG IN EAST FACE 8" WHITE PINE; N24W 20.28' SET NAIL AND MDNR TAG IN EAST FACE 18" OAK; N27E 26.92' SET NAIL AND MDNR TAG IN NW FACE 12" OAK; S50E 7.33' SET NAIL AND MDNR TAG IN NE FACE 8" OAK. | (14) SET CONCRETE MONUMENT WITH MDNR CAP NORTH 18.04' SET NAIL AND MDNR TAG IN WEST FACE 7" MAPLE; S88E 21.23' SET NAIL AND MDNR TAG IN NORTH FACE 16" OAK; S53W 20.07' SET NAIL AND MDNR TAG IN SOUTH FACE 12" OAK; N76W 21.97' SET NAIL AND MDNR TAG IN NORTH FACE 6" MAPLE. | (8) SET CONCRETE MONUMENT WITH MDNR CAP NORTH 9.79' SET NAIL AND MDNR TAG IN EAST FACE 8" W. OAK; N43E 19.17' SET NAIL AND MDNR TAG IN SE FACE 12" W. OAK; S03E 17.06' SET NAIL AND MDNR TAG IN WEST FACE 7" W. OAK; N81W 5.72' SET NAIL AND MDNR TAG IN SOUTH FACE 9" W. OAK |
|--|--|---|

Signed by Gary C. Bilow Date 8/1/91  
 Surveyor's Michigan License No. 26453

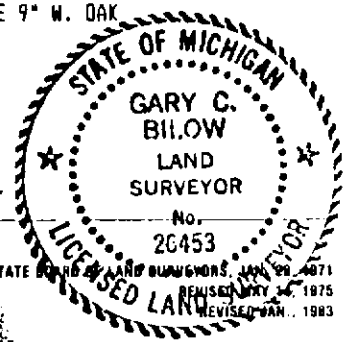

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 1971  
 REVISION MAY 1975  
 REVISED JAN. 1983