ENUMBER / DOMESTIC

MAR 07 2000

SECTION


ALLEGAN COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE FILING REQUIREMENT OF ACT 74 MICH CAR

• •	-00 '4RB	- }	Zi.	8:	35
	yaya	Œ.	·		<u></u>

			1,4, MICH. P. 0019/EB - 1 /// 8:35	
FOR CORNERS IN: ALLEGAN COUNTY	LOCATED IN:	CORNER CODE #		
1. Public Land Survey	T R. 13W	A-4 ✓	REGISTER OF DITTON ALLEGAN COUNTY MODE	
WEST 1/4 CORNER SECTION 7, ALLEGAN TOWNSHIP	T R14W	M-4		
EAST 1/4 POST, SEC. 12,	T R	***************************************		
VALLEY TOWNSHIP	T R	************		
2. Property Controlling in section	sR	*************	REGISTER OF DEEDS STAMP & FILE NUMBER	
	SR	***********		
Miscellaneous Property in Sec.	SR		ABCDEFGHIJKL	
4. Lot No,Reco	rded Plat		2 8 -5 4 -3 -2 -1	
5. Private Claims			4 + 7 + 10 11 12	
			5	

I, Raymond Moored in a field survey on Nov. 7, 1999 do hereby state that under requirments of P.A.74, Michigan P.A. of 1970, corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior Bureau of Land management or by a decree of a Court of Law and/or that the comer points mentioned in the lines 3, 4, and 5 above were in comformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law established, monumented, recovered, found as expressed below.

Note: Not more than 2 corners, all the same town and range, may be recorded on this certificate.

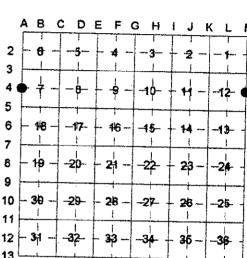

A.Description of original monument and accessories and/or subsequent restoration:

1. G.L.O. (A-4) THIS POSITION NOT ESTABLISHED BY G.L.O.

G.L.O. (M-4) NORTH ON EAST SIDE SECTION 12 40.00 SET QR. SEC. POST FOR SEC. BEECH 6 S17W 38 W. OAK 18 N51-1/2W 40 2. RATEKIN WITNESS CARD **TORSION BAR**

PP S.W. 70.2 -ST. SIGN N.E. 26.4 - N.E. COR. HSE. S.W. 94.3 -TEL CABLE MARKER N.W. 61.4 -25" MAPLE N.E. 57' -S.W. COR. HSE. 75' N.E. -36" WAI NUT 68.6 A-4 TO A-3 = 2634' A-4 TO A-5 = 2629.1'

B.Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FD. 3/4" PIPE IN MON BOX WITH 60d NAIL ALONG WEST SIDE AND 1/2" SQUARE IRON 0.10" NWLY IN BOX. HOUSE CORNER WITNESSES SW AND NE FROM NO. 2 ABOVE CHECKED OK. REMOVED ALL IRONS AND SET STANDARD ALLEGAN COUNTY REMON IRON W/ CAP IN PLACE OF 3/4" PIPE.

ACCEPTED AS A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION OF THE ORIGINAL CORNER.

APPROVED BY ALLEGAN COUNTY REMONUMENTATION PEER GROUP ON NO. 11.

TOTAL DISTANCE TRAVERSED = 2834.02 ON ROAD

APPROVED REMONUMENTATION CORNER

P.A. 345 OF 1990 ALLEGAN COUNTY

COUNTY REP.

C.Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET STANDARD 3/4" X 24" ALLEGAN COUNTY REMONUMENTATION IRON WITH CAP IN MON BOX

-NAIL & TAG IN SW SIDE TELE POST N36W 62.46 -MAIL & 1AG IN SE SIDE POWER POLE S3SW 52.AB* -NAIL & TAG IN SE SIDE POWER POLE S3SW 79.02* -NE CORNER HOUSE (2.5*+/- ABOVE MAIN FLOOR LEVEL) S41-20W 84.34* -FD SMALL MAG NAIL IN PVM*T NORTH 9.33*

Surveyors License No. 26463

PAGE 1 OF 1

