

**ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE**
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>ALLEGAN</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T <u>2N</u> R <u>13W</u>	<u>D-2</u>
	T _____ R _____	<u>CEN SEC. 5</u>
	T _____ R _____	<u>ALLEGAN TWP</u>
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

FILED
1/28/1999 2:44:39 PM
JOYCE A. WATTS
REGISTER OF DEEDS
ALLEGAN COUNTY, MICH

Register of Deeds Stamp & File Number

I, ARTHUR W. BRINTNALL, in a field survey on 27 AUG 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

D-2
G.L.O.
THIS POSITION WAS NOT ESTABLISHED BY G.L.O.
NOV. 9, 1889 J. W. HICKS, C.S.
SET CORNER MIDWAY ON LINE BETWEEN C-2 & E-2
40.38' W TO C-2
40-38' E. TO E-2
1950'S D. ALLEN, C.S.
WITNESS CARD
STONE
FE POST E. 30.5'

CONT. ON BACK OF CERTIFICATE

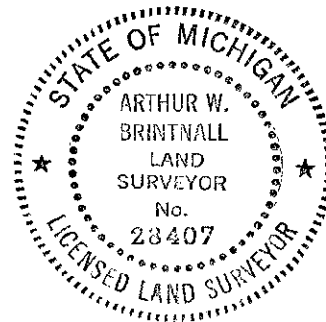

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

D-2 FND 3/4" IRON IN MON. BOX (SEE C-2 L.C.R.C.)

THIS POSITION NOT ESTABLISHED BY G.L.O..
THIS MONUMENT IS ACCEPTED AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE CORNER
APPROVED BY ALLEGAN PEER GROUP 11 AUG 98

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-2 ALLEGAN COUNTY MON (3/4 X 24" IRON W/CAP) IN MON BOX
SEE SKETCH ON BACK OF CERTIFICATE
NAIL & REMON TAG N SIDE 6" CHERRY W 60.10'
NAIL & REMON TAG NE SIDE 16" POPLAR N 60 W 30.91'
NAIL & REMON TAG SE SIDE 6" MAPLE N 20 E 75.32'
NAIL & REMON TAG S SIDE 8" WALNUT N 85 E 99.47'
IN LINE W/FE TO EAST & WEST
IN CENTERLINE 33RD ST.

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED Aug. 11, 1998
COUNTY REP. [Signature]

Signed by Arthur W. Brintnall
PREIN & NEWHOF

Date Sept. 8, 1998

Surveyor's Michigan License No. #28407

