

SURVEY & REMONUMENTATION

APR 25 1995

COMMISSION

**ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

ALLEGAN (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>2N</u> R <u>14W</u>	<u>G-13</u> <u>Valley</u>
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

1994 DEC 16 AM 9:56
 REGISTER OF DEEDS
 ALLEGAN COUNTY MICH
 [Signature]
FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	10	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Donald R. Pitts Jr., in a field survey on September 10, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessones and/or subsequent restoration:

G.L.O.-Set post corner Section 33 & 34 Circa 1900-Allegan Co. Surveyor Notes
 B. Oak 25" N.23 1/2°E. 28 Links Stake: R. Oak 6" S.W. 33.6
 Pine 11" N.63°W. 28 Links W. Oak 6" S.E. 49
 Circa 1950-Allegan Co. Surveyor W. Oak 30" N.W. 62.5
 Stake, Stone & Iron Oak 12" S.W. 42'
 Street Sign N.E. 41.9' Elm 6" S.W. 39'
 Power Pole S.E. 68.0'
 12" W. Oak S.W. 33.3'
 14" R. Oak W.S.W. 60.8'
 40" Oak N.W. 62.1'

(CONTINUED ON BACK OF CERTIFICATE)


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner

Found Iron in Mon. Box
 Power Pole S.E. 68.45'
 Ⓢ Tele. Pedestal S.W. 66.45
 Power Pole N.W. 91.63'
 24" Oak N.W. 116.10'
 Pulled Iron and set Standard Allegan Co. 3/4" X 24" Remon Iron W/Red Cap #23520 in Mon. Box.
 Approved by the Allegan Co. Remon. Peer Group on April 12, 1994, and is accepted as a careful and faithful perpetuation of the position of the original corner.
 Traversed 2644' East & 2643' West

APPROVED REMONUMENTATION CORNER
 P.A. 345 OF 1990
 ALLEGAN COUNTY
 DATE APPROVED 4-13-94
 COUNTY REP. [Signature]

C. Description of monument for corner and accessones established to perpetuate locating the position of the corner:

Standard Allegan Co. 3/4" X 24" Remon Iron W/Red Cap #23520 in Mon. Box.
 G-1, T.1N., R.14W. Standard Allegan Co. 3/4" X 24" Remon Iron W/Red Cap #23520 in Mon. Box
 West 3.93'
 Nail & Allegan Co. Remon Tag in S.W. Side Power Pole N.55°W. 91.62'
 " " " " " " " E. Side 24" Oak N.30°W. 115.65'
 " " " " " " " S.E. Side Power Pole S.40°E. 68.45'

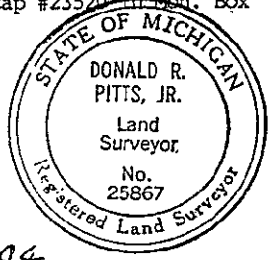

Signed by [Signature] Date 12 Sept 1994

Surveyor's Michigan License No. 25867

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JEM. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983

(CONTINUED FROM FRONT OF CERTIFICATE)

A. Description of original monument and accessories and/or subsequent restoration:

1988-Allegan Co. Surveyor Kirk L. Van Order

~~Found Iron in Mon. Box~~~~Power Pole S.E. 68.45'~~~~E Tel. Pedestal S.W. 66.45'~~

Power Pole N.W. 91.63'

24" Oak N.W. 116.10'