

MAR 15 1993

ALLEGAN COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

1993 DEC 17 PM 1:56  
Roger A. Wilton  
REGISTER OF DEEDS  
ALLEGAN COUNTY MICHIGAN

FILED

For corners in  
Allegan  
COMMISSION  
(County)

Valley Township  
Located in: Corner Code ##

1. Public Land Survey	T 2N R 14W	I-1
	T R	NW Corner
	T R	Section 2
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	13	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Chris Marschall, in a field survey on July 8, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:


NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO Set post at 85.80' N of 2, 3, 10, 11 and 96 L E of 34, 35  
 Maple 14" S 42° W 37 L  
 Beech 12" S 81° E 18 L  
 MDOT = 92.3' N of Centerline M-89  
 Ratekin File 3/4" Iron (SEE OTHER SIDE)  
 Centerline M-89 S 92'±  
 Nail NW side 18" Oak S 85° E 11.93'  
 Nail and Survey cap in N. side Twin 10" Oak N 30° E 22.00  
 Nail and survey cap in NW side Triple 10"-10"-9" Maple N 50° W 53.11'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found Axle shaft from above witnesses 0.33' South of true line and 66.37' East of Standard Corner I-13. Held as best evidence of perpetuation of the corner.

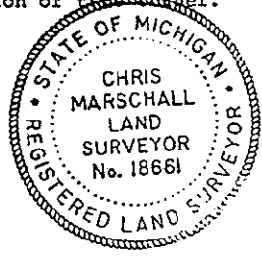

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set Standard Allegan County monument 3/4" x 36" Iron pin with cap on Township Line  
 Axle shaft South 0.33'  
 J-13 N 90° E 2587.86  
 I-13 West 63.37'  
 16" Penny cut Nail NW side 12" Oak S 66° W 29.63'  
 16" Penny cut Nail SW side Triple 12-12-12 Maple N 49° W 52.81'  
 16" Penny cut Nail NE side 6" Ironwood N 49° W 24.05'  
 16" Penny cut Nail SE side Twin 12" Oak N 42° E 21.66'  
 16" Penny cut Nail S side 22" Oak S 75° E 11.98'  
 Centerline shallow 3' wide ditch South 22'±  
 Centerline M89 South 92'±  
 Centerline top GTE Box #3997 S 34° W 49.17'

Signed by Chris Marschall Date July 8, 1993  
 Surveyor's Michigan License No. 18661

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
 REVISED MAY 14, 1975  
 REVISED JAN., 1983

LIBER 004 PAGE 243

SEE OTHER SIDE

Page 1 of 2

## Section A Continued:

Grush Found 1" diam. Axle Shaft 1977

10" Oak	N 44° E	21.92'
16" Oak	S 71° E	11.96'
6" Maple	S 71° W	29.78'
Triple 10" Maple	N 46° W	53.13'
Centerline M-89	S 92'	

NOTE: Allegan County Remon tag with 16d Duplex Nails were set on October 14, 1993  
in line with the cut nails.