

ALLEGAN COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Allegan (County)	Located In:	Corner Code #:
1. Public Land Survey	T <u>2N</u> R <u>13W</u>	<u>A-1 (NW-Cor-Sec 6)</u>
	T _____ R _____	<u>Allegan-Twp.</u>
	T _____ R _____	
	T <u>3N</u> R <u>13W</u>	<u>A-13 MONTEBEE</u>
2. Property Controlling in Section	S _____ T <u>2N</u> R <u>14W</u>	<u>M-1 VALLEY</u>
	S _____ T <u>3N</u> R <u>14W</u>	<u>M-13 HEATH</u>
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	
	S _____ T _____ R _____	

1993 DEC 30 PM 2:42  
 REGISTER OF DEEDS  
 ALLEGAN COUNTY, MICH.  
 FILED  
 Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, David R. Greer, in a field survey on December 18, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therofore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- A-1
- Government Notes - 1831
- Post
- Beech 6" S26°W 4 links
- Beech 8" N76°E 5 links


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- A-1
- Found steel bar iron monument box over culvert and replaced steel bar with A.C. Remonumentation iron and cap and accepted it as a careful and faithful perpetuation of the position of the original corner.

REMONUMENTATION  
 NOV 1 1995  
 COMMISSION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- A-1
- A.C. Remonumentation Iron & Cap in Monument Box over Culvert
- Set A.C. Remon nail & tag in NE Side 12" Ash AZ. 328°40' 67.27'
- Set A.C. Remon nail & tag in N Side Tri 10" Ash AZ. 292°30' 69.22'
- Set A.C. Remon nail & tag in S Side 26" Hickory AZ. 270°12' 152.29'
- NE Cor House Foundation AZ. 107°09' 201.22'
- Set A.C. Remon nail & tag in N Side Power Pole AZ. 90°07' 177.62'
- A-2 (W 1/4 Cor Sec 6) AZ. 180°00'

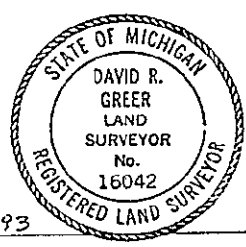

Signed by David R. Greer  
 Surveyor's Michigan License No. 16042

Date 12/16/93

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
 REVISED MAY 14, 1975  
 REVISED JAN., 1983