

RECORDED &  
 MAR 07 2000  
 SECTION

ALLEGAN COUNTY REMONUMENTATION  
 LAND CORNER RECORDATION CERTIFICATE  
 Filing Requirement of Act 74, Mich. P.A. 1970

FILED

CO FEB -1 AM 8:39

ALLEGAN COUNTY REGISTER

For corners in  
 Allegan (County) Located In: Corner Code #

1. Public Land Survey T2N R16W K-10  
 T R  
 T R West 1/4 corner  
 T R Section 25  
 Ganges Twp.

2. Property Controlling S T R  
 in Section S T R  
 3. Miscellaneous S T R  
 Property in Sec. S T R

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

*Jayce L. Bette*  
 REGISTER OF DEEDS  
 ALLEGAN COUNTY, MICH.

Register of Deeds Stamp & File Number

I, Steve Lampen, in a field survey on December 22, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:  
 K-10 1831 - C. Britain 1971 Allegan County Road Commission  
 Set post Set 1" iron  
 B. Ash 6 N 83 W 13 1/2" iron rod N 80 W 45.87  
 B. Ash 13 N 83 E 23 N end CMP driveway culvert S 50° W 33.6'

1969 County Surveyor's Records Found iron (destroyed during road construction)  
 3/4" iron Set 1" iron  
 In line with ditch West 1/2" iron rod N 80° W 45.87'  
 37" Maple NE 32.5' N end CMP driveway culvert S 50° W 33.6'  
 30" Maple NW 40.2'  
 Quad clump Maple WSW 36.9'  
 26" Maple SW 48'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
 K-10 Found 1/2" diameter steel bar in monument box. N end CMP driveway culvert S 50° W 33.6' N end CMP driveway culvert S 50° W 33.6' In line with ditch West K-10 to K-9 record = N 0° 07' 14" E 2595.22 meas. = N 0° 07' 11" East 2595.48 K-10 to K-11 record = S 0° 08' 24" W 2622.69 meas. = S 0° 08' 37" W 2622.83


Replaced 1/2" iron with an Allegan County Remonumentation iron and cap and accepted it as a careful and faithful perpetuation of the position of the original corner.

Approved by the Allegan County Remonumentation Peer Group on December 28, 1999.  
 Traversed 5218' on road.

APPROVED REMONUMENTATION CORNER  
 P.A. 345 OF 1990  
 ALLEGAN COUNTY  
 DATE APPROVED DEC. 28, 1999  
 COUNTY REP. *[Signature]*

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 K-10 Allegan County Remonumentation iron and cap in monument box.  
 Azimuth = Michigan State Plane grid direction

8" Pine, remonumentation tag in S side	54° 04'	61.74'
8" Pine, remonumentation tag in S side	42° 21'	74.75'
8" Pine, remonumentation tag in S side	83° 32'	50.13'
8" Pine, remonumentation tag in SW side	132° 18'	67.41'
Centerline N and S asphalt road pavement	90°	1'

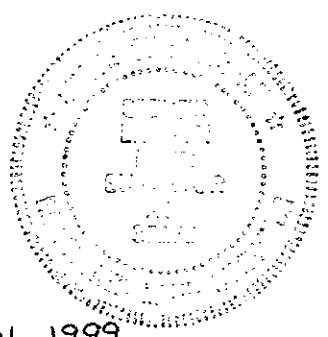

Signed by Steven Lampen Date DECEMBER 31, 1999

Surveyor's Michigan License No. 37279