

**ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE**
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Allegan
County

COMMISSIONER

Located In: Corner Code #

- | | | | | | | |
|------------------------------------|---|---|----|----|---|------|
| 1. Public Land Survey | T | 2 | NR | 16 | W | K-13 |
| | T | | R | | | |
| | T | | R | | | |
| | T | | R | | | |
| 2. Property Controlling in Section | S | | T | | R | |
| | S | | T | | R | |
| 3. Miscellaneous | S | | T | | R | |
| Property in Sec. | S | | T | | R | |

George J. Mitchell
REGISTER OF DEEDS
ALLEGAN COUNTY MICHIGAN

1993 DEC 30 PM 2:45

FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, George J. Mitchell, in a field survey on December 17, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	6	5	4	3	2	1					
5												
6	10	9	8	7	6	5	4	3	2	1		
7												
8	13	12	11	10	9	8	7	6	5	4	3	2
9												
10	16	15	14	13	12	11	10	9	8	7	6	5
11												
12	19	18	17	16	15	14	13	12	11	10	9	8
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


	<u>K-13</u>		
G.L.O. Notes	MacDougalls note book	April 1992	
W. 80.00 ch set post	Flat iron & brick	fd. 1/2" Pipe	
corner sec 35 & 36	Power Pole SE 46.6'	15" Pine West 8.11'	
Beech 9" N22E 20lks	26" Ash ENE 40.9'	15" Pine West 32.12'	
Beech 8" N87W 60lks	6" Pine N 17.0'	Power Pole South 53.12'	
		10" Maple N45W 30.35'	
		Square iron Post East 43.93'	
		1/2" Iron East 143.93'	
		1/2" Iron East 243.93'	

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-13

Corner was lost during recent road construction. Re-established corner location from offset irons and witnesses and accepted location as a careful and faithful perpetuation of the position of original corner.

15" Pine	West	32.20'
Power Pole	S05W	53.12'
1/2" iron	East	143.93'
1/2" iron	East	243.93'

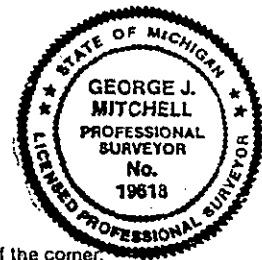

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

	<u>K-13</u>	
Set A.C. remonumentation 3/4" iron & cap.		
A.C. remon tag & nail in North side of Guy Pole	AZ. 260°	34.56'
A.C. remon tag & nail in East side of Power Pole	AZ. 175°	53.12'
A.C. remon tag & nail in West side of Power Pole	AZ. 130°	84.25'
A.C. remon tag & nail in SW side of Power Pole	AZ. 100°	84.25'
1/2" Rebar	AZ. 91°	143.93'
1/2" Rebar	AZ. 91°	243.93'

Signed by *George J. Mitchell* Date 12-29-93
Surveyor's Michigan License No. 19618

LIBER 004 PAGE 339