

APR 07 1998

SECTION

ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Allegan (County)	Located In: Wayland Twp.	Corner Code #
1. Public Land Survey	T3N R11W	✓ G-2
	T___ R___	_____
	T___ R___	_____
	T___ R___	_____
2. Property Controlling in Section	S___ T___ R___	_____
	S___ T___ R___	_____
3. Miscellaneous Property in Sec.	S___ T___ R___	_____
	S___ T___ R___	_____

98 JAN 21 PM 1:38
Jasper A. C. [Signature]
REGISTER OF DEEDS
ALLEGAN COUNTY, MICH.

FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Robert Jonker, in a field survey on 9-03, 1994 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	10	11	12	13	14	15	16	17	18	19	20	21	22
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													


A. Description of original monument and accessories and/or subsequent restoration:

1831 Sylvester Sibley D.S. old maps calls for
North between Sec. 3 & 4 12"x12"x6" stone
40.00 ch. set 1/4 sec. post 1869 E. Strong
Birch 7 S11 8
Do 9 North 12

Ratekin, 1983
Set 1/2" pipe-per info: from
prev. surveys
C/L 14" Pine S60°E 91.5'
C/L 16" Maple S15°E 49.4'
C/L 30" Maple South 70.0'
NE cor. hse. siding
S30°E 118'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 5/8" solid bar in mon box by Kirk VanOrder wit. of 1990

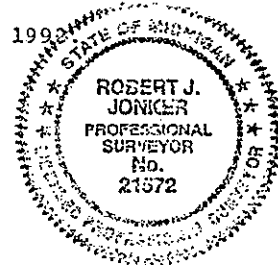

Accepted as a careful and faithful perpetuation of the position of the original corner.

Peer group approved Dec. 30, 1997.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Replaced with 3/4"x36" std. capped allegan County Monument
Allegan County Remon Tag & Nail - E. side 8" Maple Az. 345° 43.88'
Allegan County Tag & Nail - Top of 8" post Az. 80° 136.36'
Found nail on W. side of p. pole Az. 175° 35.02'
NE corner conc. block garage Az. 150° 139.16'
on line fence & tree row to South
C/L E-W pavement is 2' North

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED 12-30-97
COUNTY REP. K.V.O.

Signed by Robert J. Jonker
Surveyor's Michigan License No. 21572

Date 12-15-97

USER:0006 PAGE:247

OVER FOR SHEET 2

"A" cont'd

Jonker, 1983

Found $\frac{1}{2}$ " iron per Ratekin wit. of 1983

Tw. 14" Pine is out

Kirk VanOrder, 1992

Found 1" iron in mon. box

Nail E. side 7" Maple NNW 43.90'

Nail W. side P. pole SSE 35.03'

Nail NE side 18" Tw. Maple SE 49.34'

NE corner house fndn. SE 118.2'