

SURVEY & REMONUMENTATION

APR 07 1998

ALLEGAN COUNTY REMONUMENTATION
 LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

<u>Allegan</u> (County)	Located In:	Corner Code#
	Wayland Twp.	
1. Public Land Survey	T <u>3</u> N R <u>11</u> W	<u>G-4</u>
	T ___ R ___	___
	T ___ R ___	___
	T ___ R ___	___
2. Property Controlling in Section	S ___ T ___ R ___	___
	S ___ T ___ R ___	___
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	___
	S ___ T ___ R ___	___

98 JAN 21 PM 1:38
 Register of Deeds
 ALLEGAN COUNTY, MICH.
Robert J. Jonker

FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Robert Jonker, in a field survey on 9-03, 1994 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	5	5				3		2				
3												
4	7	9	9	10		11		12				
5												
6	10	17	16	15		14		13				
7												
8	19	20	21	22		23		24				
9												
10	30	29	28	27		26		25				
11												
12	31	32	33	34		35		36				
13												

A. Description of original monument and accessories and/or subsequent restoration:

1831 Sylvester Sibley D.S. old notes 1889
 North between Sec. 9 & 10 T.O. Williams - Sleigh shoe & stone
 40.00 ch. set 1/2 post Ratekin survey 1971 (L-9-2) & LCRC 1-250 - 1972
 W. Oak 20 N2E 35 Part "B" - Fd. iron in 1965±
 Maple 9 S16E 55 took witnesses
 old notes 1917 Iron 14" Oak E 24.5' Fnc. cor. W. 25'
 14" Oak NE 27' 24" Oak NNW 75' Fnc. cor. E. 20'
 12" Elm NW 30.4' 12" Locust NW 50.4' same wit. in part "C"
 17" Maple SW 26.4' also corner is 1/2"x1 1/2" iron

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found 1/2"x1 1/2" iron (Sleigh shoe) set on end 1' below road grade - all over stone 32" below grade
 Found per old witness from LCRC #1-250
 17" Maple is out

Accepted as a careful and faithful perpetuation of the position of the original corner.

Peer group approved Dec. 30, 1997.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Replaced iron with std. Allegan County capped monument
 Allegan County Remon Tag & Nail - S. side 36" Oak Az. 85° 24.75'
 Allegan County Remon Tag & Nail - SE side 15" Maple Az. 225° 48.41'
 Allegan County Remon Tag & Nail - S. side 8" Elm Az. 310° 26.00'
 Allegan County Remon Tag & Nail - NW side 4" Tw. Pine Az. 30° 46.25'
 on C/L N-S gravel road & on line old E-W fence

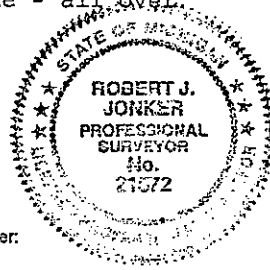

APPROVED REMONUMENTATION CORNER
 P.A. 345 OF 1990
 ALLEGAN COUNTY
 DATE APPROVED 12-30-97
 COUNTY REP. K.V.O.

Signed by Robert J. Jonker
 Surveyor's Michigan License No. 21572

Date 12-15-97