

SURVEY & REMONUMENTATION

APR 29 1996
COMMISSION


ALLEGAN COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in	WAYLAND TOWNSHIP	
Allegan	Located in:	Corner Code #
(County)		
1. Public Land Survey	T 3N R 11W	H-3
	T R	1/4 Corner
	T R	Common to
	T R	Sections 3 & 10
2. Property Controlling in Section	S T R	Wayland Township
3. Miscellaneous Property in Sec.	S T R	

FILED
1995 DEC 29 PM 4 08
JAYAN C. MARSHALL
REGISTER OF DEEDS
ALLEGAN COUNTY, MICHIGAN
Register of Deeds Stamp & File Number:

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

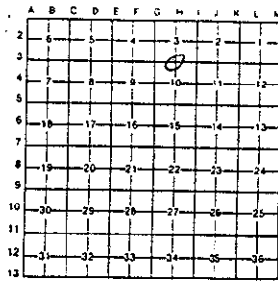

I, Chris Marschall, in a field survey on March 23, 1995 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefor as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
GLO Set Corner @ 40.11 Chains Beech 9 for 1/4 Cor.
Old Notes (No dates)
Stake and Stone
Maple 14" SE 24.9'
Maple 8" SE 33'
SW Cor. Mag. Var. 3°-7' 40.19 Chains (2652.54')
SE Cor. Mag. Var. 3°-39' 40.27 1/2 Chains (2658.15)
Center Mag. Var. 4°-41'

1973 Set 1" Iron centerline Road East 15'
Fence East North 403'
"T" in 30" Rock N30°W 11.3'
1989 1" Pipe
Spike E side 3" Sassa N45°W 25.43'
Spike S side 4" Sassa N65°W 30.79'
PK N side M-B Post S85°W 6.77'
Gravel Road East 6'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Found 1" Iron set in 1973
Found 1" Pipe 8.75' East of 1" Iron
Held 1" Pipe - Pipe is within 1.5' of split and appears to be the point used for all surveys recorded in section 10 & 3.
Spike in E. side 4" Sassa N45°W 25.4'
Fence to E North 403'
Both the Iron Pin and the Pipe appear to be on the same E-W line

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED 4-11-95
COUNTY REP. Chris Marschall

APPROVED BY ALLEGAN COUNTY PEER GROUP DATE 4/11/95

And is accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
H-3 Set 3/4" x 24" Steel Pin with Plastic Remon Cap in Place of 1" Pipe that was found
1/2" x 18" Rebar West 100.00'
1/2" x 18" Rebar West 200.00'
1/2" x 18" Rebar West 300.00'
PK in E. side P. Pole S 08° W 249.13'
Nail and Remon tag in N side 18" Maple N 84°W 118.07'
Centerline Gravel Road East 6'
Centerline Gravel Drive South 11'
Fence to East North 403'



SEE OTHER SIDE

Signed by Chris Marschall Date March 23, 1995
Surveyor's Michigan License No. 18661

REF 0005 PAGE 330

Sheet 1 of 2

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 26, 1971
REVISED MAY 14, 1978
REVISED JAN., 1983

SURVEY &
REMONUMENTATION

APR 29 1996

COMMISSION

SECTION C CONTINUED

SW Cor.	N 88°20'50"W	2630.39'
SE Cor.	S 88°54'18"E	2633.51'
Center of Section 3	N 00°29'49"E	2702.32'
Center of Section 10	S 00°53'18"W	2627.63'

The monument set was the Standard Allegan County Remonumentation Iron with the Standard Red Plastic Cap #23520

ALLEGAN COUNTY RECORDS
RECORDED
APR 29 1996
11:00 AM
RECORDS & CLERK