

SURVEY & REMONUMENTATION

APR 25 1995

COMMISSION

ALLEGAN COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Allegan (County)

Located In: _____ Corner Code E-4

1. Public Land Survey T 3N R 12W
 T _____ R _____ E 1/4 Cor.
 T _____ R _____ Sec. 8
 T _____ R _____ W 1/4 Cor.
 T _____ R _____ Sec. 9

2. Property Controlling in Section S _____ T _____ R _____
 S _____ T _____ R _____ Hopkins Twp.

3. Miscellaneous Property in Sec. S _____ T _____ R _____


4. Lot No. _____ Recorded Plat _____

5. Private Claims _____

1994 DEC 30 PM 12:16
 REGISTER OF DEEDS
 ALLEGAN COUNTY MICHIGAN
 REGISTER OF DEEDS STAMP & FILE NUMBER

FILED

I, Kirk Van Order, in a field survey on April 22, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

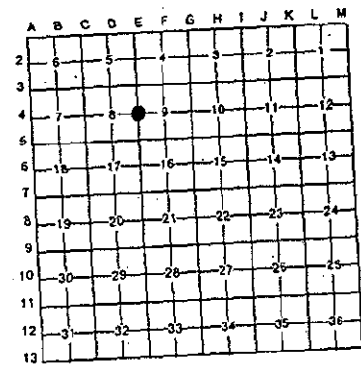

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- E-4
- GLO set post 40.00 chains North of E-5. 10 links
 - 18" Beech S49°W 31 links
 - 16" Beech N71°E
 - Old notes, Gardner, shows stone set at corner, April 8, 1878
 - 20" Maple NW 21'
 - 14" Maple SE 43'
 - 14" Maple NE 43.5'

(Continued on back of sheet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-4
 Fd. capped iron 1/2" x 18" by using K.V.O. survey info.
 Also found stone mentioned in LCRC recorded in Liber 2 on Page 71 tilted and lying to the South of found iron.

And is accepted as a careful and faithful perpetuation of the position of the original corner.

Peer Group approved 5-10-94.

APPROVED REMONUMENTATION CORNER
 P.A. 345 OF 1990
 ALLEGAN COUNTY
 DATE APPROVED 5-10-94
 COUNTY REP. Kirk Van Order

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- E-4
 Set standard Allegan Co. Remon. monument (3/4" x 36" steel rod w/red cap #23520)
- | | | |
|--|-------------|---------|
| Nail & Remon. tag in S side 53" Maple | AZ. 261°45' | 283.32' |
| Nail & Remon. tag in SW side 36" Maple | AZ. 115°53' | 69.71' |
| Nail & Remon. tag in SE side 32" Maple | AZ. 54°57' | 53.73' |
| SW corner brick house | AZ. 36°40' | 152.69' |
| SE corner brick house | AZ. 60°21' | 189.62' |

Signed by [Signature]
 Surveyor's Michigan License No. 23520

Date 12-30-94

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 29, 1971
 REVISED MAY 14, 1976
 REVISED JAN., 1983

Section A (continued from Page 1)

E-4

- LCRC (L. 2, P. 71) 11-22-1972
 - Set 1/2" x 8" iron w/cap over c/l of flat stone (8" x 5" x 2")
 - C/L Tele. Pole N75°W 44.95'
 - C/L 26" Maple N40°W 44.00'
 - C/L 34" Maple N50°W 41.10'
 - C/L 28" Maple N60°W 53.90'
 - C/L 30" Maple S30°E 69.75'
 - C/L Street Sign S45°W 34.95'
- Ratekin witness card shows LCRC ties above except tele. pole is gone.
- Ratekin survey (K-8-1) 12-1-1972 shows LCRC ties above.
- K.V.O. survey (86-975) 7-29-1986
 - Fd. capped iron
 - 30" Maple NE 53.70'
 - 36" Maple SE 68.91'
 - C/L Tele. Ped. NW 32.70'
 - C/L Street Sign SW 34.95'

REPRODUCED FROM THE
 ORIGINAL SURVEY RECORDS
 OF THE MISSOURI GEOLOGICAL SURVEY