

REMONUMENTATION

MAY 05 1997

COMMISSION

ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Allegan County	Located In:	Corner Code #:
1. Public Land Survey	T-2N-R-13W-	A-1 (NW-Cor-Sec 6)
	T- R-	Allegan Twp.
	T- R-	
2. Property Controlling in Section	* T-3N-R-13W	A-13 MANTERREY
	S- T-2N-R-14W	M-1 VALLEY
	S- T-3N-R-14W	M-13 HEATH
3. Miscellaneous Property in Sec.	S- T- R-	
	S- T- R-	

1993 DEC 30 PM 2:42
REGISTER OF DEEDS
ALLEGAN COUNTY, MICH.
John A. Carter

FILED

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

I, David R. Greer, in a field survey on December 10, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
2												
3												
4												
5												
6												
7												
8												
9												
10												
11												
12												
13												

A. Description of original monument and accessories and/or subsequent restoration:


- A-1 Government Notes - 1831
- Post
- Beech 6" S26°W 4 Inks
- Beech 6" N76°E 5 Inks

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- A-1 Found steel bar in monument box over culvert and replaced steel bar with A.C. Remonumentation iron and cap and accepted it as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- A-1 A.C. Remonumentation Iron & Cap in Monument Box over Culvert
- Set A.C. Remon nail & tag in NE Side 12" Ash AZ. 328°40' 67.27'
- Set A.C. Remon nail & tag in N Side Tri 10" Ash AZ. 232°30' 89.22'
- Set A.C. Remon nail & tag in S Side 25" Hickory AZ. 270°12' 152.29'
- NE Cor House Foundation AZ. 107°09' 201.22'
- Set A.C. Remon nail & tag in N Side Power Pole AZ. 90°07' 177.62'
- A-2 (W 1/4 Cor Sec 6) AZ. 180°00'

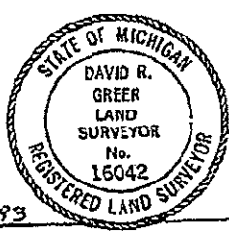

Signed by David R. Greer
Surveyor's Michigan License No. 16042

Date 12/16/93

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 26, 1971
REVISED MAY 14, 1985
REVISED JAN., 1993