

ALLEGAN COUNTY REMONUMENTATION
 LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

ALLEGAN

(County)

Located In:

Corner Code ~~---~~

1 Public Land Survey

T -3N R-13W

L-3 (S1, 1)

T _____ R _____

MONTEREY TWP

T _____ R _____

T _____ R _____

Property Controlling
 in Section

S _____ T _____ R _____

S _____ T _____ R _____

3 Miscellaneous
 Property in Sec

S _____ T _____ R _____

S _____ T _____ R _____

4 Lot No. _____, Recorded Plat _____

5 Private Claims _____

1995 DEC 14 PM 2:35
 REGISTER OF DEEDS
 ALLEGAN COUNTY

FILED

Register of Deeds Stamp & File Number

SURVEY &
 REMONUMENTATION

APR 29 1996

COMMISSION

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	6	5	4	3	2	1						
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, BASIL ADDRESS in a field survey on 16 MAR. 19 95
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules therofore as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law, established, re-established, monumented, re-monumented, recovered, found as
expressed below

NOTE: Not more than 4 corners, all in the same town and range, may be recorded
on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
 G.L.O.
 WEST CORRECTED LINE BETWEEN SECTIONS 1 & 12
 39.98 SET QUARTER SEC. POST
 ELM 10" S 68° E 56 LKS
 ELM 8" S 32° W 43 LKS


APPROVED REMONUMENTATION CORNER
 P.A. 345 OF 1990
 ALLEGAN COUNTY
 DATE APPROVED 3-14-95
 COUNTY REP. [Signature]

CONT. ON BACK OF CERTIFICATE

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 FD 1/2" PIPE
 CHECKS W/ WITNESSES FROM L.C.R.C. L-004, P-169

THIS CORNER IS ACCEPTED AS A CAREFUL AND FAITHFUL PERPETUATION OF THE
 POSITION OF THE ORIGINAL CORNER.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 REPLACED 1/2" PIPE W. STD. ALLEGAN CO. MON. (3/4" X 24" PIN & CAP)
 16d & REMON. TAG. NE SDE 12" CHERRY N 55° W 146.90'
 16d & REMON. TAG N SDE 16" ELM S 55° W 93.07'
 16d & REMON TAG E SDE P.P. S 05° E 104.87'
 1/2" IRON & STEEL FE POST N 45° E 90.22'
 1/2" IRON & STEEL FE POST S 45° E 110.89'
 IN C/L 134TH AVE
 IN LINE W/ C/L 25TH ST TO NORTH

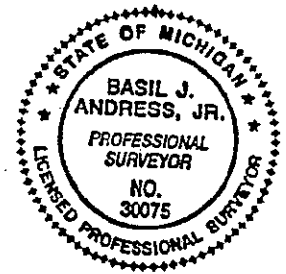

Signed by [Signature]

Date 18 APR 95

Surveyor's Michigan License No. 30075

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN. 1983

0005 PAGE 256

SHEET 1 OF 2

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATIONS

OLD NOTES FROM PREVIOUS COUNTY SURVEYOR'S OFFICE

SEC - 12

DIST. WEST TO SW COR - 40.27

DIST. EAST TO SE COR - 40.27

SEC - 1

DIST OF 5319.6 FOR S. LINE

DIST NORTH TO CENTER - 2649.24

CALLS FOR CEDAR STAKE @ S $\frac{1}{2}$ COR.

AUG. 1981 DONALD A. RATEKIN, C.S.

SET $\frac{1}{2}$ " IRON FROM PRIOR SURVEY

JULY, 1983 ROBERT J. JONKER, P.S.

REC'D SURVEY L- 1061, P- 267

N $\frac{1}{2}$ COR - IRON

ST. SIGN POST S 45° W 25.34'

NAIL W. SDE 30" COTT. N 7° E 179.5'

C/L STOP SIGN POST N 70° E 49.8'

JAN., 1986 R.E. MOORED, P.S.

FD $\frac{1}{2}$ " PIPE

60 d SPK W. SDE 36" ASH NNE 179.60'

IN C/L 25TH ST TO N.

IN C/L 134TH AVE.

C/L TEL. CAB. BX NNE 63.88'

S. EDGE STOP SIGN POST NE 38.50'

E. EDGE E. POST DIRECTION SIGN SSW 17.82

DIST. E TO SE COR - 2656.13'

DIST. W TO SW COR - 2659.70'

DIST. N TO CENTER - 2649.38'

JULY, 1992 WALLACE EDWARD GLAZA

L.C.R.C. L- 004, P- 169

FD IRON PIPE

1) NAIL IN W. SIDE 36" TREE N 05° E 179.56'

2) NAIL IN NW SIDE 16" TREE S 54° W 93.07'

3) C/L STOP SIGN N 63° E 40.26'

4) NW COR BARN FND S 61° E 366.44'

REC'D SURVEY L- 1361, P- 155 THRU 162