

ALLEGAN COUNTY REMONUMENTATION
 LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Allegan
 (County)

Located In: Corner Code #
 1. Public Land Survey T 3N R 14W F-7
 T ___ R ___ N 1/4 Cor.
 T ___ R ___ Sec. 21
 T ___ R ___ S 1/4 Cor.
 2. Property Controlling S ___ T ___ R ___ Sec. 16
 in Section S ___ T ___ R ___ Heath Twp.
 3. Miscellaneous S ___ T ___ R ___
 Property in Sec. S ___ T ___ R ___

REGISTER OF DEEDS
 ALLEGAN COUNTY, MICH.

1993 DEC 30 PM 2:44

FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	15	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Kirk VanOrder, in a field survey on October 12, 19 93
 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
 in lines 1 and 2 above were in conformance with regulations and rules therofore as required in the
 current manual of survey instructions of the United States Department of the Interior, Bureau of Land
 Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
 Court of Law; established, re-established, monumented, re-monumented, recovered, found as
 expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded
 on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- F-7
 •GLO set post @ 39.38 chains West of G-7.
 12" Pine S17°W 39 links
 18" W. Oak N2°E 32 links
 •MacDougall notes 1907 Gas pipe
 •D.N.R. notes 1936
 1" iron pipe
 12" W. Oak NW 81.6'
 10" B. Oak SW 64.7'
- 14" B. Oak SE 59.5'
 •LCRC (L.2, P.95) 5-9-1973
 •LCRC (L.3, P.298) 11-10-1980
 2" iron pipe
 Tw. 8" Oak SE 27.73'
 24" Oak S,SW 41.80'
 3" Oak NW 31.12'
 30" Pine NE 80.95'
 •Kistler survey (L.830, P.711) 5-18-1973
 •K.V.O. survey (L.1142, P.527) 4-10-1985

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- F-7
 Found 2" iron pipe
 Nail in E side 24" B. Oak SW 42.75'
 Nail & MDSH tag in W side Power Pole N,NW 34.49'
 Nail in NE side 14" B. Oak S,SE 50.68'
 Nail in SE side 31" W. Pine N,NE 77.60'


Accepted as a careful and faithful perpetuation of the position of the
 original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- F-7
 Replaced iron pipe with standard Allegan Co. monument (3/4" x 30" steel rod
 with cap)
 Nail & Allegan Co. Remon. tag in 24" B. Oak S,SW 42.74'
 Nail & Allegan Co. Remon. tag in Power Pole N,NW 34.49'
 Nail & Allegan Co. Remon. tag in 14" B. Oak S,SE 50.58'
 Nail & Allegan Co. Remon. tag in 31" W. Pine N,NE 77.42'

Signed by [Signature] Date 12-30-93

Surveyor's Michigan License No. 23520

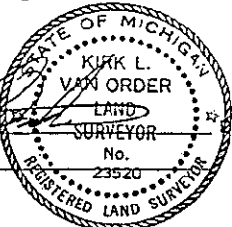

LIBER 004 PAGE 325