

**SURVEY
REMONUMENTATION**

APR 29 1999

SECTION

For corners in

**ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

Allegan
(County)

Located in:

Corner Code #

1. Public Land Survey

T 3N R 14W H-1
T R Heath Twp.

2. Property Controlling in Section

S T R
S T R
S T R
S T R

3. Miscellaneous Property in Sec.

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

FILED

1/28/1999 2:44:39 PM

JOYCE A. WATTS
REGISTER OF DEEDS
ALLEGAN COUNTY, MICH

LIBRO 006 PAGE 31

Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Kirk L. Van Order, in a field survey on June 12, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- H-1
(1) Not set by GLO
(2) LCRC by David R. Greer, Liber 003, Page 370, dated Nov. 1983
Set concrete monument (4" dia. x 36") on line and midway between G-1 and I-1
14" tree SE 67.00'
8" tree SW 44.10'
10" tree N,NE 24.85'
S 1/4 cor. Sec. 34 W 19.20'

(continued on back of sheet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-1
Fd. a 4" dia. x 36" long concrete monument with 1/2" steel re-rod protruding from top and the following accessories as listed in No. 3 above. Adjusted concrete monument North 0.08' to bring it to the town line.

This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner.
Peer group approved Sept. 8, 1998.

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY

DATE APPROVED SEPT. 8, 1998
COUNTY REP. [Signature]


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

H-1
Affixed a standard Allegan Co. Remon. red plastic cap to top of re-rod in concrete monument

- | | | |
|---|---------------|----------|
| Nail & Remon. tag in NW side 11" maple | AZ 30° | 59.76' |
| Nail & Remon. tag in SW side 12" elm | AZ 155° | 42.00' |
| Nail & Remon. tag in SW side 9" ash | AZ 290° | 21.69' |
| Nail & Remon. tag in SW side 38" tw red oak | AZ 310° | 91.27' |
| C/L 2-track rd | AZ 90° | 4'+/- |
| H-13, T.4N., R.14W. | AZ 270°37'08" | 19.10' |
| I-1, T.3N., R.14W. | AZ 90°37'08" | 2605.99' |

Signed _____
Surveyor's Michigan License No. 23520

Date 12-23-98

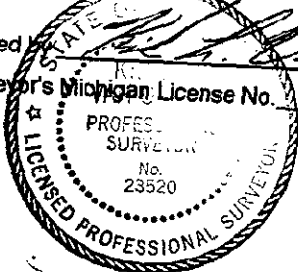

SURVEY
REMONUMENTATION

APR 29 1998

SECTION

Section A (continued from Page 1)

H-1

Heath Twp., T.3N., R.14W.

- (3) Kirk L. Van Order, R.L.S. survey dated Feb. 19, 1988
Fd. conc. monument
- | | | |
|------------------------------------|------|--------|
| 17" ash | SE | 67.00' |
| 10" ash | SW | 44.10' |
| 14" elm | N,NE | 42.90' |
| C/L 2-track rd. | E | 8'+/- |
| S. 1/4 cor. Sec. 34, T.4N., R.14W. | W. | 19.20' |
- (4) Kirk L. Van Order, R.L.S. survey dated Nov. 18, 1997
Fd. conc. monument
(same witness info. as in No. 3)

LIBR0006 PAGE 32