

COMMISSION

ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Allegan
(County)

Located In:

Corner Code ##

- | | | |
|---------------------------------------|----------------------------|-------------------|
| 1. Public Land Survey | T <u>3</u> N R <u>14</u> W | <u>I-8</u> |
| | T ___ R ___ | <u>E 1/4 Cor.</u> |
| | T ___ R ___ | <u>Sec. 22</u> |
| | T ___ R ___ | <u>W 1/4 Cor.</u> |
| 2. Property Controlling
in Section | S ___ T ___ R ___ | <u>Sec. 23</u> |
| | S ___ T ___ R ___ | <u>Heath Twp.</u> |
| 3. Miscellaneous
Property in Sec. | S ___ T ___ R ___ | |
| | S ___ T ___ R ___ | |

Spencer A. ...
REGISTER OF DEEDS
ALLEGAN COUNTY, MICH.

1993 DEC 30 PM 2:44

FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Kirk VanOrder, in a field survey on December 15, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules theretofore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	15	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- I-8
- GLO set post @ 40.00 chains North of I-9.
 - 11" Pine N52°W 6 links
 - 16" Pine S80°E 34 links
 - MacDougall survey
 - Showed a stake with no witnesses

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-8
Dug a 5' x 5' square area and found no evidence of stake. Did find barbed wire fence running North and South on ground approximately 5.5' West of a point midway and on line between corners I-9 and I-7.


Set I-8 on line and midway between I-9 and I-7.

Accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- I-8
Set standard Allegan Co. monument (3/4" x 30" steel rod with red plastic cap)
- | | | |
|---|-------|----------|
| Nail & Allegan Co. Remon. tag in S side 12" R. Oak | E | 16.98' |
| Nail & Allegan Co. Remon. tag in N side 20" B. Oak | S80°W | 34.32' |
| Nail & Allegan Co. Remon. tag in NE side 6" B. Oak | N20°W | 26.29' |
| Nail & Allegan Co. Remon. tag in NW side 10" Tw. B. Oak | N50°E | 23.22' |
| Barbed wire fence on ground running N & S | W | 5.5' +/- |

Signed by *Kirk L. VanOrder*
Surveyor's Michigan License No. 23520

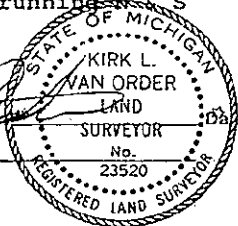

12-30-93

LIBER 004 PAGE 332