

MAR 16 1994

Allegan County Remonumentation
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

CO. Allegan (County)

Located in:

Corner Code #

- 1. Public Land Survey T 4N R 13W A-13(SW, 31)
T _____ R _____ Salem Twp.
T 3N R 13W A-1(NW, 6)
T _____ R _____ Monterey Twp.
- 2. Property Controlling S _____ T 4N R 14W M-13(SE, 36)
in Section S _____ T _____ Overisel Twp.
- 3. Miscellaneous S _____ T 4N R 14W M-1(NE, 1)
Property in Sec. S _____ T _____ Heath Twp.

Register of Deeds Stamp & File Number

1993 DEC 17 PM 1:56
REGISTER OF DEEDS
ALLEGAN COUNTY, MICH.
James C. Bueche

FILED

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	13	17	16	15	14	13						
7												
8	18	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, John C. Bueche, in a field survey on October 26, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

A-13 corner common to 4 Twps.	3/4" pipe 12-12-81
1" pipe 1968	Nothing recorded
TP NE 53.4'	in any twps.
34" Maple SE 66.6'	VanOrder Survey
St. sign SW 42.4'	40" Maple SE 67.9'
TP SSE 91.0'	C/L gas marker post NE 59.2'
2472.04' E to S 1/4	NW cor. tel. pedestal SE 91.0'
31, 4-13	PP SW 96.05'
	3/4" pipe 8-29-91
	VanOrder Survey same wit. as above

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


A-13 Found 1" x 30" iron in bit. road @ surface	
34" Maple SE 66.6'	40" Maple SE 67.9'
Meas. E to S 1/4 31, 2472.74'	C/L gas marker post NE 59.2'
Meas. E to N 1/4 6, 3-13, 2439.74'	NW cor. tel. pedestal SE 91.0'
	PP SW 96.05'

And is accepted as a careful and faithful perpetuation of the position of the original corner

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-13 Replaced 1" iron with Std. Allegan Co. Mon. (3/4" x 24" rod & cap)
 Conc. Nail & Allegan Tag in NE side 12" Maple N 40° W 56.67'
 C/L 2" gas pipe marker N 75° E 59.15'
 Conc. Nail & Allegan Tag in W side 16" Pine S 30° E 68.88'
 Conc. Nail & Allegan Tag in W side dbl. 14" Pine S 15° E 83.45'
 Conc. Nail & Allegan Tag in SE side PP S 50° W 96.05'
 On C/L bit. E-W
 C/L gravel N is W 5'±
 C/L gravel S is W 12'±
 Meas. by hand

Signed by John C. Bueche Date Oct 26 1993
Surveyor's Michigan License No. 13027

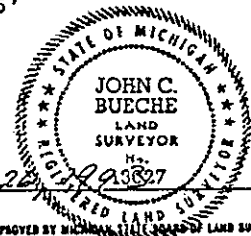

FORM APPROVED BY MICHIGAN BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983