

FILED

MAR 07 2000

ALLEGAN COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

00 FEB -1 AM 8:41

SECTION

For corners in

Allegan (County)	Located in:	Corner Code #
1. Public Land Survey	T3N R14W	M-12 Heath Twp.
	T___ R___	_____
	T___ R___	_____
	T___ R___	_____
2. Property Controlling in Section	S___ T___ R___	_____
	S___ T___ R___	_____
3. Miscellaneous Property in Sec.	S___ T___ R___	_____
	S___ T___ R___	_____

*Joyce Anderson*  
REGISTER OF DEEDS  
ALLEGAN COUNTY, MICH.

LIBRARY 001 PAGES 03

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	10		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

Kirk L Van Order in a field survey on NOV 2, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- M-12  
 (1) GLO North on East side of Section 36 40.00 Set quarter section post  
 A pine 20" dia. N.18W. 47 lks  
 An ash 13" dia. N.71W. 3 lks  
 (2) Holland Engineering, Inc. info. John Kistler & Assoc., W.R.B. 1975  
 Fd. stone Set conc. mon.  
 36" maple NW 50.43'  
 16" pine W,SW 47.80' (continued on back of sheet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- M-12  
 Fd. 1-1/2" x 14" iron pipe above concrete monument in mon. box and the following witnesses:  
 16" (now 20") pine W.,SW 47.80'  
 P. pole SE 79.90'  
 Removed iron pipe and set a standard Allegan Co. monument above concrete monument in mon. box. And is accepted as a careful and faithful perpetuation of the position of the original corner. APPROVED REMONUMENTATION CORNER  
 P.A. 345 OF 1990  
 ALLEGAN COUNTY  
 DATE APPROVED Nov. 9, 1999  
 COUNTY REP. *[Signature]*  
 Peer group approved Nov. 9, 1999.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- M-12  
 Standard Allegan Co. Remon. monument (3/4" x 1.4' steel rod w/red cap #23520)  
 PK Nail & Remon. tag in top W side wood fence post AZ 30° 71.34'  
 Nail & Remon. tag in SW side power pole AZ 150° 79.69'  
 PK Nail & Remon. tag in S side 20" spruce AZ 255° 46.77'  
 PK Nail & Remon. tag in NE side 25" hemlock AZ 330° 68.48'  
 Iron pipe in mon. box AZ 02° 14.45'

Signed by *[Signature]*  
Surveyor's Michigan License No. 23520

Date 12-30-1999

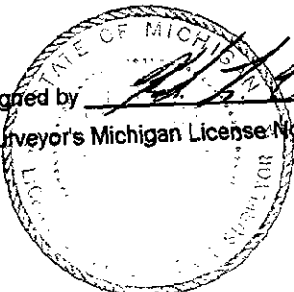

RE

MAR 07 2000

SECTION

LAND 007 PAGE 3 OF 4

Section A (continued from Page 1)

M-12

Heath Twp., T.3N., R.14W.

(continued No. 2)

- 20" maple S.,SW 50.72'
- P.P. SE 79.90'
- W. 1/4 corner Sec. 31 - 3-13 N. 14.53'
- (3) Kirk L. Van Order survey, dated Oct. 20, 1992 shows E 1/4 corner Sec. 36
- Fd. conc. mon.
- 36" maple NW 50.43'
- 16" pine W,SW 47.80'
- 20" maple S,SW 50.72'
- P. pole SE 79.90'
- (4) Kirk L. Van Order survey, dated June 21, 1994 shows E. 1/4 corner Sec. 36
- Fd. pipe in mon. box 0.08' North of former position of conc. mon.
- 36" maple NW 50.43'
- 16" pine W,SW 47.80'
- Power pole SE 79.90'
- (5) Kirk L. Van Order survey, dated Sept. 30, 1997 E. 1/4 corner Sec. 36
- Shows same ties as in No. 3