

**SURVEY
REMONUMENTATION**

APR 29 1999

SECTION

**ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

FILED

1/28/1999 2:44:39 PM

JOYCE A. WATTS
REGISTER OF DEEDS
ALLEGAN COUNTY, MICH

L10E0006 PAGE 85

For corners in <u>Allegan</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T3N ___ R15W ___ T ___ R ___ T ___ R ___ T ___ R ___	E-1 NW corner, Section 4, Manlius Twp.
2. Property Controlling in Section	S ___ T ___ R ___ S ___ T ___ R ___	
3. Miscellaneous Property in Sec.	S ___ T ___ R ___ S ___ T ___ R ___	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Steve Lampen _____, in a field survey on December 4, 1998, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
E-1 L.C.R.C. L2, P213 - Ratekin - 1973
GLO - Britain-Brookfield - March 7, 1832 Set 1" iron
North between Section 4 and 5 NE cor. house S 40° W 64.85
82.22 North boundary 2.30 West of post SW cor. house N 20° E 62.48 (porch)
and set corner to Sec.'s 4 and 5 16" Ash S 20° E 32.6
Elm 20 S 24 E 10 1/2" iron with cap S 45° E 45.93
Elm 20 S 30 W 43

Road Commission
Hicks - 1874 Fillmore iron E 151.80 ft.
D-1 to E-1 = 40.25 ch. PK in 18" Walnut SE 76.38
E-1 to G-1 = 80.5 ch. NE cor. house SW 64.65
PK in 24" Maple N 42.64

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
E-1 Found 1" iron in monument box 0.73 ft. North of the South line of Section 32, Town 4 North, Range 15 West, NE corner house, S 40° W 64.79 (measured 64.85) SW corner house N 20° E 62.51 (measured 62.48) SW corner Section 33, Town 4 North, Range 15 West is East 151.8.

Set 3/4"x24" Allegan County Remonumentation iron and cap at the GLO and record jog of 151.80 ft. on the South line of Section 32 and accepted it as a careful and faithful perpetuation of the position of the original Corner.

Traversed 2637 ft. on road.


This corner was accepted by the Allegan County Remonumentation Peer Group on December 8, 1998.

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED DEC. 8, 1998
COUNTY REP. [Signature]

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
E-1 3/4"x24" Allegan County Remonumentation iron and cap on the South line of Section 32, Town 4 North, Range 15 West

Azimuth = Michigan State Plan grid direction

SW corner concrete block building	62° 30'	224.16'
SW corner house, foundation	15° 44'	68.32'
SE corner porch, foundation	293° 07'	144.87'
NW corner house, foundation	238° 16'	85.38'
NE corner house, foundation	223° 54'	64.33'
Iron in monument box	359°	0.73'
E-13, Town 4 North, Range 15 West	90° 26'	151.80'

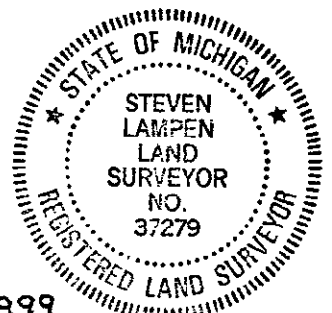

Signed by Steven Lampen

Date JANUARY 11, 1999

Surveyor's Michigan License No. 37279