

MAY 2 1997

ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Allegan (County)	Located in:	Corner Code #
1. Public Land Survey	T 3N R 15W	F-5 (S 1/4, 9) Manlius Twp.
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

97 JAN 22 PM 1:26
REGISTERED MAIL
ALLEGAN COUNTY
REGISTER OF DEEDS STAMP & FILE NUMBER

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

I, Kirk L. Van Order, in a field survey on Aug. 12, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	16	17	18	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

- F-5
(1) GLO West between Sec. 9 & 16 40.25 chains (2656.50')
Set 1/4 Sec. post
Maple 10 S15°E 20
Do 10 N24°W 25
(2) T.O. Williams survey notes dated Feb. 1889
Measured South 80.55 chains (5316.30') from F-3 to F-5 South
1/4 corner Section 9, Found wit. tree, too wet to find stake
(continued on back of sheet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

F-5
Kirk L. Van Order Remon. survey dated Aug. 12, 1996
Didn't find any evidence of corner or fence lines running from it
Set F-5 position midway and on line from E-5 to G-5, and is
accepted as a careful and faithful reestablishment of the position
of the original corner. 5358.09' off road traverse.
Measured West 2679.045' to E-5
Measured North 5304.79' to F-3
Measured East 2679.045' to G-5

APPROVED REMONUMENTATION CORNER
P.A. 343 OF 1990
ALLEGAN COUNTY
DATE APPROVED 10-8-96
COUNTY REP. *[Signature]*


Peer group approved Oct. 8, 1996.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- F-5
Set standard Allegan Co. Remon. monument (3/4" x 36" steel rod
w/red cap #23520)
Nail & Remon. tag in NE side 18" Ash N25°W 55.30'
Nail & Remon. tag in E side 13" Maple N10°W 47.33'
Nail & Remon. tag in SE side 10" Maple
(cluster) N25°E 33.33'
Nail & Remon. tag in SE side 6" Maple N70°E 40.88'
Traverse spike AZ 356°29'06" 34.21'

Signed by *[Signature]*
Surveyor's Michigan License No. 23520

Date 12-31-96

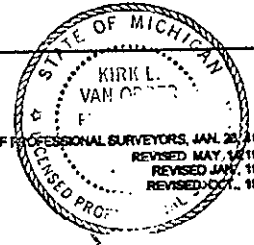

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY, 1975
REVISED JAN., 1983
REVISED OCT., 1985

SECTION

707

SECTION

Section A (continued from Page 1)

F-5

Manlius Twp., T.3N., R.15W.

- (3) D.A.R. Ratekin & Assoc. survey for C.P.C. computed position midway and on line between E-5 and false corner eye bolt near G-5