

ALLEGAN COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

COMMISSION

Allegan (County)

Located In:

Corner Code #

- 1. Public Land Survey T 3N R 16W G-2 (W 1/4 Sec 3) Saugatuck Twp.
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R

1993 DEC 30 PM 2:42
REGISTER OF DEEDS
ALLEGAN COUNTY, MICH.

FILED

Register of Deeds Stamp & File Number

- 4. Lot No. Recorded Plat
5. Private Claims

Grid table with columns A-M and rows 2-13. A dot is marked at the intersection of column G and row 3.

I, David R. Greer, in a field survey on December 6, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- G-2 Recorded in Liber 1 Page 182, March 3, 1972
40" Beech SW 28.83'
30" Oak N60°W 71.67'
30" Oak N15°W 95.84'
CL of Road E 5.00'
G-2 Government Notes 1831
Post
Beech 10" N38°E 29 links
Beech 6" N71°W 7 links

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- G-2 Found steel bar in monument box and accepted it as a careful and faithful perpetuation of the position of the original corner
10" Twin Ash cap #14091 in S Side NW 92.91'
Nail & Washer SW End Pine Trail Camp Sign NW 74.06'
P.K. East Side 30" Oak NW 96.11'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- G-2 Replace Steel Bar in monument box with Allegan County Remonumentation Iron & Cap.
A.C. Remon tag & nail in S Side 12" Oak AZ. 71°43' 36.23'
Found Nail in E Side 32" Oak AZ. 336°18' 96.14'
Found Nail in W Side Twin 12" Oak AZ. 203°15' 79.94'
A.C. Remon tag & nail in SW Side 10" Ash AZ. 119°19' 108.57'
A.C. Remon tag & nail in SE Side 12" Oak AZ. 221°23' 99.31'
A.C. Remon tag & nail in NE Side 16" Ash AZ. 305°05' 92.99'

Signed by David R. Greer
Surveyor's Michigan License No. 16042

Date 12/14/93

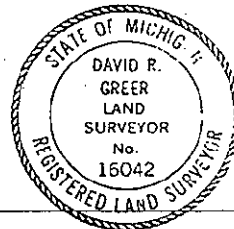

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983