

ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Allegan
(County)

Located in: Corner Code #

1. Public Land Survey T3N R16W I-8
T R F 1/4 Cor.
T R Sec. 22
T R W 1/4 Cor.
S T R Sec. 23
S T R Saugatuck Twp.

2. Property Controlling in Section

3. Miscellaneous Property in Sec.

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

James ...
REGISTERED PROFESSIONAL SURVEYOR
No. 33976

1995 DEC 14 PM 2:37

FILED

Register of Deeds Stamp & File Number

SURVEY &
REMONUMENTATION

APR 29 1996

COMMISSION

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Gerald T. Ford, in a field survey on October 12, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I-8	LCRC	
Government Land Office	L 3-P 133	
Survey Notes, 1831	January 13, 1976	
Surveyor - Lucius Lyon	Iron	
Post		
9" Hemlock N 40° E 22 links	P.K. nail E side twin 12" & 16" Cherry	N 05° W 31.02'
18" Hemlock S 65° W 33 links	P.K. nail SW side 34" Oak	N 45° W 34.64'
	P.K. nail SW side 16" Ash	N 45° E 35.60'
	Centerline field drive E 22'	

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


I-8
Found 3/4" iron
P.K. nail E side twin 20" & 24" Cherry AZ 358° 31.08'
P.K. nail SW side 38" Oak AZ 319° 34.73'
Centerline field drive E 22'±
Replaced 3/4" iron with A. C. Remon. iron and cap.

Approved by the Allegan Co. Remonumentation Peer Group on November 14, 1995, and is accepted as a careful and faithful perpetuation of the position of the original corner.

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED 11-14-95
COUNTY REP. *[Signature]*

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-8
Allegan County Remonumentation iron and cap
Nail & tag in E face 24" twin Wild Cherry AZ 398° 31.07'
Nail & tag in W face 38" Oak AZ 319° 34.05'
Nail & tag in N face 12" Poplar AZ 239° 22.03'
Nail & tag in W face 16" Oak AZ 189° 37.83'
Centerline field drive AZ 90° 22'±

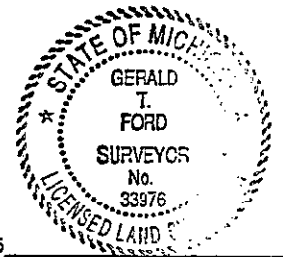

Signed by *Gerald T. Ford* Date November 14, 1995

Surveyor's Michigan License No. 33976