

SURVEY & REMONUMENTATION

APR 07 1998

**Allegan County Remonumentation
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

SECTION

For corners in

Allegan (County)	Located In:	Corner Code ##
1. Public Land Survey	T <u>4N</u> R <u>14W</u>	✓ D-1 (N1, 5) Overisel Twp.
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

98 JAN 21 PM 1:27
REGISTER OF DEEDS
ALLEGAN COUNTY, MICH.
John C. Bueche

FILED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, John C. Bueche, in a field survey on May 6, 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

D-1 GLO	Survey L949, P414	Survey L910, P058	Survey
Not set	HEI, Oct., 1978	HEI, June, 1979	VanOrder
	Set steel bar	Same as L949, P414	April, 1982
	TP ENE 98.35'	Survey L, P	Same as L949,
	28" Ash SW 85.10'	HEI, Oct., 1979	P414
	Ottawa Co. East 74.91'	Same as L949, P414	

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

D-1 Found 1" steel bar in bit. rd. on South line of Twp. to the North
As per above wit.

Meas. West 2669.23' NW 5 (HEI 1979 2669.35')
Meas. East 2669.21' NE 5 (HEI 1979 2668.74')

Traverse C-13 to D-13 2641.90'


This position not established by original government surveyors.
This monument is accepted as the best available evidence of the position of the corner.

Peer group approved May 13, 1997.

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED 5-13-97
COUNTY REP. K.V.O.

C. Description of monument for corner and accessones established to perpetuate locating the position of the corner.

D-1 Replaced 1" steel bar with Allegan Co. Mon. (3/4" x 24" pin with cap) in bit. rd., on South line of Twp. to the North
Nail & Allegan Co. Remon. Tag in NW side 40" Ash S 55° W 85.06' (5.5' above ground)
Nail & Allegan Co. Remon. Tag in W side 22" Ash S 20° W 73.34'
Nail & Allegan Co. Remon. Tag in W side 10" W. Cherry S 13° E 57.86'
Nail & Allegan Co. Remon. Tag in NE side 10" Maple S 50° E 72.33'
Ottawa Co. Mon. in Mon. Box (S 1/4 32, 5-14) East 74.91'
C/L bit. E-W, South 1.5'±; bit. rd. N, East 75'±

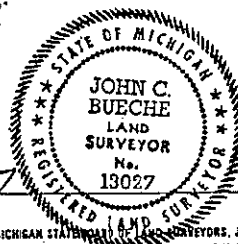


Signed by John C. Bueche, P.S. 13027
Surveyor's Michigan License No. _____

Date 10-22-97

FORM APPROVED BY MICHIGAN STATE BOARD OF SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

FILED 0006 PAGE 181

Sheet 1 of 2



Sec 32 5-14

