

ALLEGAN COUNTY REMONUMENTATION  
 LAND CORNER RECORDATION CERTIFICATE  
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Allegan  
(County)

Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_

1. Public Land Survey	T <u>4N</u> R <u>14W</u>	<u>F-10</u>
	T _____ R _____	<u>Center</u>
	T _____ R _____	<u>Sec. 28</u>
	T _____ R _____	<u>Overisel Twp.</u>
2. Property Controlling in Section	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____	S _____ T _____ R _____	_____
5. Private Claims _____	S _____ T _____ R _____	_____

1995 DEC 14 PM 2:36  
 REGISTERED PROFESSIONAL SURVEYOR  
 ALLEGAN COUNTY, MICHIGAN  
 FILED

**SURVEY & REMONUMENTATION**  
**APR 29 1996**  
**COMMISSION**

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						

I, Kirk Van Order, in a field survey on April 4, 19 95  
 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:  
F-10  
 ● Not set by GLO  
 ● Hugh McDougall survey notes early 1900's  
 Stone at corner  
 Tele. pole NE 23  
 Pine stump SE 162  
 ● Holland Engineering, Inc. survey  
 Set PK nail at corner

APPROVED REMONUMENTATION CORNER  
 P.A. 345 OF 1990  
 ALLEGAN COUNTY  
 DATE APPROVED 5-9-95  
 COUNTY REP. Kirk L. Van Order


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
F-10  
 Fd. PK nail  
 Intersected 1/4 lines of Section 28 and fd. PK nail 0.09' South of intersection point  
 Measured North 2643.03' to N 1/4 corner on road  
 Measured East 2612.84' to E 1/4 corner on road  
 Measured South 2636.71' to S 1/4 corner on road  
 Measured West 2629.07' to W 1/4 corner on road  
 This position not established by original government surveyors.  
 This monument is accepted as the best available evidence of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
F-10  
 Removed PK nail and set standard Allegan Co. Remon. monument (3/4" x 24" steel rod w/red cap #23520)  
 C/L gas pipeline vent pipe  
 Nail & Remon. tag SE side support pole  
 Nail & Remon. tag SE side power pole  
 Nail & Remon. tag NE side power pole

AZ. 38°11'	49.95'
AZ. 205°41'	61.06'
AZ. 240°19'	105.51'
AZ. 328°22'	174.19'

Signed by Kirk L. Van Order  
 Surveyor's Michigan License No. 23520

Date 12-13-95

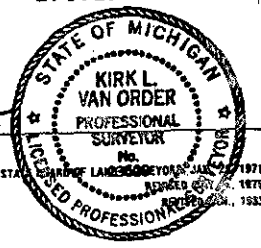

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JULY 1, 1971  
 REPRINTED 1975