

REMONUMENTATION

APR 07 1998

SECTION

Allegan County Remonumentation
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Allegan (County)	Located In:	Corner Code #
1. Public Land Survey	T 4N R 14W	L-1 (N1, 1)
	T R	Overisel Twp.
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

98 JAN 21 PM 1:35
REGISTER OF DEEDS
ALLEGAN COUNTY MI

FILED

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, John C. Bueche, in a field survey on May 9, 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- L-1 GLO
Not set
- LCRC L3, P239, Feb., 1979 Byl
Set iron pipe on Twp. line
midway between NE & NW cor.
16" Oak NE 23.25'
T Iron E 17.41'
Iron S 33.07'
10" Oak NW 23.80'
36" Tw. Beech SSW 95.75'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

L-1 Found capped 3/4" x 36" pipe #23502 Byl on South line of Twp. to the North
As per above wit.

Meas. dist. West to NW cor. 1 2654.77'

Traverse K-13 to L-13 2644.18'


This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner.

Peer group approved May 13, 1997.

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED 5-13-97
COUNTY REP. K.V.B.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- L-1 Replaced pipe with Allegan Co. Mon. (3/4" x 36" pin with cap) on South line of Twp. to the North
- Nail & Ottawa Co. Remon. Tag in N side 12" Oak N 35° W 24.10'
- Nail & Ottawa Co. Remon. Tag in E side 8" Ash N 10° E 44.85'
- Nail & Ottawa Co. Remon. Tag in SE side 12" Ash N 45° E 46.16'
- Nail & Ottawa Co. Remon. Tag in S side 6" Ash N 80° E 27.25'
- Nail & Allegan Co. Remon. Tag in S side 16" Maple N 70° W 29.37'
- On N edge of clearing
- Ottawa Co. Mon. (S 1/4 36, 5-14), East 17.41'
- Power line E-W, South 37'±

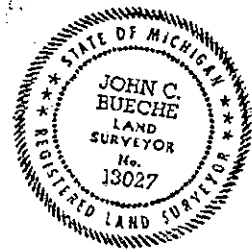

Signed by John C. Bueche P.S. Date 10-27-97
Surveyor's Michigan License No. 13027

REF: 0006 PAGE 201

Sheet 1 of 2

