

REF

MAR 07 2000

SECTION

ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Allegan
(County)

Located in:

Corner Code #

- 1. Public Land Survey T 4N R 14W M-11
 T ___ R ___ Overisel Twp.
- 2. Property Controlling S ___ T ___ R ___
 in Section S ___ T ___ R ___
- 3. Miscellaneous S ___ T ___ R ___
 Property in Sec. S ___ T ___ R ___

Joyce L. ...
REGISTER OF DEEDS
ALLEGAN COUNTY, MICH.

00 FEB - 1 AM 8:49

1800#07#18

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

I, Kirk L Van Orden in a field survey on Oct 29, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

M-11
(1) GLO
North E. side Sec. 36
80.00 Set post cor. Sections 25 & 36
Beech 5 N25W 33
Beech 9 S40W 40

(continued on back of sheet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-11
Fd. 3/4" steel rod and the following witnesses:
C/L 138th Ave. N. 72.0'
30" oak (now 41") N.10°W. 61.1'
Removed steel rod and set a standard Allegan Co. Remon. monument and is accepted as a careful and faithful perpetuation of the position of the original corner.
Peer group approved Nov. 9, 1999.

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED Nov. 9, 1999
COUNTY REP. *[Signature]*


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-11
Standard Allegan Co. Remon. monument (3/4" x 36" steel rod w/red cap #23520)
Nail & Remon. tag in SE side 15" s pine AZ 60° 70.01'
Nail & Remon. tag in NE side 21" s pine AZ 125° 55.97'
Nail & Remon. tag in NE side 20" r. oak AZ 310° 72.02'
Nail & Remon. tag in top of 6" x 6" wood gate post AZ 335° 28.84'
A-11, T.4N., R.14W. AZ 00° 46.20'

(continued on back of sheet)

Signed by _____
Surveyor's Michigan License No. VAN23520

Date 12-30-1999

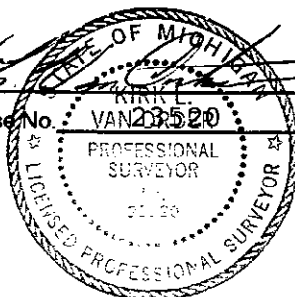

MAR 07 2000

SECTION

LIBRO 007 PAGE 19

Section A (continued from Page 1)

M-11

Overisel Twp., T.4N., R.14W.

- (2) LCRC recorded in Liber 1 on Page 390 by Donald A. Ratekin, dated June 6, 1972
 - Set 1" iron
 - St. sign North 79.55'
 - C/L 36th St. East 13.5'
 - C/L 138th Ave. N. 72.0'
 - P. pole N.25°E 126.9'
 - 30" oak N.10°W. 61.1'
- (3) D.A.R. witness card
 - Section 25, Overisel Twp.
 - Set 1" iron April 1972
 - (Same info as in No. 2)
- (4) Holland Engineering, Inc.
 - Same info as in No. 2

Section C

C/L gravel road	AZ 90°	10.5'
Fd. 5/8" iron pipe	AZ 00°	72.17'
C/L 138th Ave.	AZ 00°	72'