

REMONUMENTATION

APR 25 1995

COMMISSION

ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

1994 DEC 30 PM 12:16
REGISTER OF DEEDS
ALLEGAN COUNTY MICHIGAN
Spencer D. Webster

FILED

Allegan (County) Located In: Corner Code #
 1. Public Land Survey T 4N R 16W G-2-W1/4 Cor-
 T R Sec-3
 T R Laketown Twp.
 T R
 2. Property Controlling S T R
 in Section S T R
 3. Miscellaneous S T R
 Property in Sec. S T R

Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat
 5. Private Claims

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	16	17	18	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, John P. Clapp, in a field survey on December 7, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-2 Genl. Land Office Survey Notes 1831 Lucius Lyon, Surveyor Set Post	G-2 Recorded in Liber 1, Page 300, May 4, 1972 1 1/4" Pipe 48" Oak N55°E 40.0'	G-2 Recorded in Liber 4 Page 23, March 13, 1987 Iron in Mon. Box Hyd., Top CL NE 51.51'
6" Beech N43°E 4 links	T. Pole N40°E 43.25'	Most W'ly SW Cor Hse Fnd NE 101.52'
6" Beech N73°W 15 links	St. Sign N45°W 35.2'	10" Oak Nail in E Side NNW 121.10'
	12" Oak S50°W 57.2'	10" Maple Tag #16042 WNW 90.50'
		10" Oak Tag #16042 SW 67.80'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-2
Found 1" iron pipe in monument box and accepted it as a careful and faithful perpetuation of the position of the original corner.

CL Top of Hydrant	AZ. 33°	51.42'
Found Nail & Tag in S Side 14" Maple	AZ. 295°	90.48'
Found Nail & Tag in SE Side 12" Oak	AZ. 227°	67.81'


APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED 12-13-94
COUNTY REP. Spencer D. Webster

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-2
Set A.C. Remon Cap & Iron in Monument Box

A.C. Remon Tag & Nail in W Side 24" Maple	AZ. 27°	73.85'
A.C. Remon Tag & Nail in NE Side T. Pole	AZ. 156°	75.78'
A.C. Remon Tag & Nail in NW Side 20" Oak	AZ. 205°	89.15'
A.C. Remon Tag & Nail in SSW Side 30" Tw. Oak	AZ. 302°	117.29'

Signed by John P. Clapp *John P. Clapp* Date Dec. 8, 1994
 Surveyor's Michigan License No. 14091

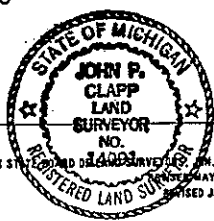

FORM APPROVED BY MICHIGAN SURVEYORS BOARD MAY 14, 1975
REVISED JAN., 1983

W:\DocSet\Surv\Remon.doc

0005 PAGE 114

G-2
Old County Surveyor Records show "stone"
30" Black Oak NE 41.00'
20" Maple NW 55.5'
8" Maple NW 61.5'

APPROVED BY THE BOARD OF COUNTY COMMISSIONERS
DATE APPROVED: 11/11/03
COUNTY SURVEYOR