

MAR 16 1993
 For corners in
 COMMISSION
 Allegan (County)

ALLEGAN COUNTY REMONUMENTATION
 LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

1993 DEC 30 PM 2:41
 REGISTER OF DEEDS
 ALLEGAN COUNTY, MICH.
James A. Carter

FILED

Register of Deeds Stamp & File Number

	Located In:	Corner Code #
1. Public Land Survey	T <u>4N</u> R <u>16W</u>	<u>H-13 (S-1/4 Sec-34)</u>
	T _____ R _____	<u>Laketown Twp.</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, David R. Greer, in a field survey on December 6, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:


H-13			R-13
Recorded in Liber 1 Page 304, May 4, 1972			Government Notes 1831
1" Iron Pipe			Post
1" Iron Pipe Jog Corner	E	10.23'	Maple 7" N49°E 9 links
NE Cor House	S45°W	80.50'	Maple 7" N50°W 23 links
SE Cor RR Tie at water's edge	N50°E	60.54'	

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-13		
Found 1" iron pipe and accepted it as a careful and faithful perpetuation of the position of the original corner		
1" Iron Pipe Jog Corner	E	10.23'
NE Cor House	S45°W	80.50'
SE Cor RR Tie at water's edge	N50°E	60.54'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-13		
Replaced 1" Iron Pipe with A.C. Remon Iron & Cap		
NW Cor Hse, Conc. Blk.	AZ.	249°12' 122.64'
A.C. Remon tag & nail in SW Side 24" Maple	AZ.	343°27' 21.31'
A.C. Remon tag & nail in E Side 26" Oak	AZ.	180°20' 88.24'
A.C. Remon tag & nail in NE Side 12" Oak	AZ.	157°18' 111.98'
SE Garage Cor, Conc. Blk.	AZ.	218°00' 100.77'
Iron Pipe H-1(N 1/4 Sec 3, T3N R16W)	AZ.	90°44' 10.27'

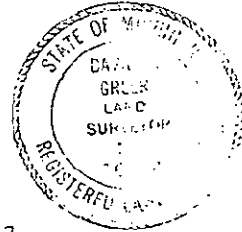

Signed by David R. Greer Date 12/14/93
 Surveyor's Michigan License No. 16042