

ALLEGAN COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

MAR 16 1994
For corners in

Allegan County

Located in:

Corner Code #/

- 1. Public Land Survey T AN R 16W M-1 (NE Sec 1)
T R Laketown-Twp.
T R
T R
- 2. Property Controlling S T R
in Section S T R
- 3. Miscellaneous S T R
Property in Sec. S T R

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

REGISTER OF DEEDS
 ALLEGAN COUNTY, MICHIGAN
James L. Schetter

1993 DEC 30 PM 2:42

FILED

Register of Deeds Stamp & File Number

I, David R. Greer, in a field survey on November 22, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therelore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	6	5	4	3	2	1					
5												
6	8	7	6	5	4	3	2	1				
7												
8	9	8	7	6	5	4	3	2	1			
9												
10	10	9	8	7	6	5	4	3	2	1		
11												
12	11	10	9	8	7	6	5	4	3	2	1	
13												

A. Description of original monument and accessories and/or subsequent restoration:


M-1 Recorded in Liber 3, Page 61, March 22, 1976 Iron found in monument box Nail in side of Power Pole SE 39.91' CL Hydrant NE 44.49' Nail in Side of Guy Pole NW 37.99'	M-1 Recorded in Liber 2, Page 377, March 27, 1975 Found iron in monument box Nail & Cap in Guy Pole NW 380.00' PK Nail in NE Side Power Pole SE 39.90' SW Cor 12" x 12" Concrete NE 45.70' Cor of Fence Post
Government Notes 1831 Post Beech 6" N59°E 53 links Hemlock 8" S31°W 25 links	

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-1
Found iron in monument box and accepted it as a careful and faithful perpetuation of the position of the original corner.
Nail in Side of Power Pole SE 39.91'
CL Hydrant NE 44.99'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-1 Replaced iron in monument box with A. C. Remonumentation Iron & Cap AZ - Michigan State Grid Direction	A.C. Remon tag & nail in NW Side 18" Pine AZ. 48°56' 137.78'
A.C. Remon tag & nail in N Side 12' Pine	AZ. 112°18' 103.00'
A.C. Remon tag & nail in S Side 18" Maple	AZ. 244°51' 98.83'
A.C. Remon tag & nail in NE Side 14" Maple	AZ. 310°17' 75.70'
A.C. Remon tag & nail in S Side 14" Pine	AZ. 70°12' 148.39'
A.C. Remon tag & nail in E Side 12" Oak	AZ. 136°12' 104.10'

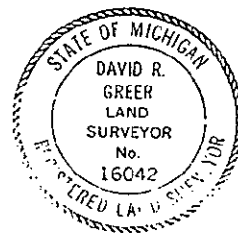

Signed by David R. Greer Date 12/14/93
Surveyor's Michigan License No. 16042

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 29, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

W:\Dec1\Sort\Ramoa.doc