SURVEY & REMONUMENTATION

OCT 1 9 1999

1998 ALPENA COUNTY REMONUMENTATION CORNER

0	EC.	rin	ΝÝ

For corners in

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74

Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN County of Alpena Recorded 12-22-1998 12:43:53 Kathe J. Matash REGISTER OF DEEMS


Corner Code # Located In: Alpena (County) H - 11T29NR_7E_ 1. Public Land Survey Ossineke Twp. R 2. Property Controlling in Section 3. Miscellaneous Property in Sec.

Register of Deeds Stamp & File Number

4. Lot No	, Recorded Plat
5. Private Claims	

I. Thomas L. Fabis, in a field survey on <u>Dec. 4</u>, 19 <u>98</u> do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

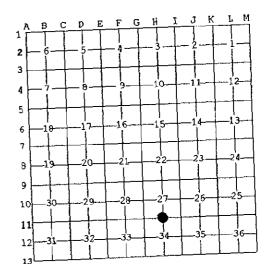

A. Description of original monument and accessories and/or subsequent restoration: 1839: G.L.O. Survey Lewis Clason Set Sec. post & referenced: Cedar 12 N49W 12, Do 8 S39E 18.

1909: County Survey Jos. McNeil Set 1/4 S. 27 and 34 in road bed.

1974: Survey W.O. 4-4974 James Scott Found R.R. and referenced.

NO DATE: Rd. Comm. Surv. Notes Gary St. Charles Ex. 1/2" Rerod & referenced. 1982: Survey L.2 P.278 D.R.MacNeill Fd. 1/2" Rerod & referenced.

1995: Survey W.O. 4-2414-S Earl Lewis Ex. 1/2" Rerod & referenced.

1997: Survey Notes Wilcox/Hendricks Rebar Fence to N. & S.

P.A. 345 ALPENA COUNT PEER APPROVED 10/11/47

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" iron rod 4 feet South of centerline of Scott Rd. (gravel surface), on line with old N-S fence to the North. Also, found 2 existing witnesses: shiner in Fe. Cor. Post - North - 38.52' and Lewis tag in P. Pole - N6E - 38.21'.

The position of this corner is compatible with county and local surveys and is accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3" dia. aluminum cap, stamped to identify the corner, over the existing 1998: 1/2" iron rod. Witnesses are:

Exis. shiner in Fence Post North 38.52 Exis. Lewis Tag in P. pole N6E 38.21' Set Tag #31591 in 8" Cedar S60W 71.79'

Set Tag #31591 in 7" Spruce S20W 22.59' Set Tag #31591 in Fe. Post N20W 41.11'

×

SATE OF MICHIGA Thomas & Fabis THOMAS L.

Date December 21, 1998

Surveyor's Michigan License No. 31591

FABIS SUNO. 31591 AND SURVINITION

CRM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14,1975 REVISED JAN., 1983 REVISED OCT., 1996