

MAY 16 1997

1996 Alpena County Remonumentation Corner

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Alpena
(County)

Located in:

Corner Code #

- 1. Public Land Survey T 29N R 8E C-6
- T R
- T R
- T R
- 2. Property Controlling S T R
- in Section S T R
- 3. Miscellaneous S T R
- Property in Sec. S T R

STATE OF MICHIGAN
County of Alpena
Recorded
10-17-1996 11:45:
Kathy J. Matash
REGISTER OF DEEDS

Liber **00002** Page **0059**

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L
2	6	5	4	3	2	1					
3											
4	7	8	9	10	11	12					
5											
6	18	17	16	15	14	13					
7											
8	19	20	21	22	23	24					
9											
10	30	29	28	27	26	25					
11											
12	31	32	33	34	35	36					
13											

I, Daniel T. Kibbe in a field survey on July 1, 19 96, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1839: GLO Survey by Lewis Clason - set post & referenced: Fir 8 - S 18 W - 12 / Y. Birch 7 - N 27½ E - 18.
- 1910: County Survey by Jos. W. McNeil - in road bed.
- 1992: Survey by Tom Fabis, LCRC - set ½" iron rod over existing 1½" gas pipe.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- 1996: Found Fabis bar & cap located 3' W. of C/L Spruce Rd. and 4' S. of old fence mound to W.

This corner position is compatible with county and local surveys.
This corner position is accepted as a careful and faithful perpetuation of the position of the original corner.

P.A. 345 ALPENA COUNTY
PEER APPROVED 7/18/96
D. P. B. [Signature]

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- 1996: Placed 3" Alpena County cap stamped to identify the corner over existing 1/2" iron rod 6" below grade. Iron rod is over existing 1 1/2" gas pipe.
- Referenced:
 - S 85° E - 32.32' - Fd. N/Tag in 6" Apple
 - N 86° E - 32.84' - Fd. N/Tag in fence post
 - S 12° W - 149.25' - Fd. N/Tag in Power Pole
 - N 58° E - 38.58' - Set N/Tag in fence post
 - N 73° W - 29.29' - face of GTE cable marker post

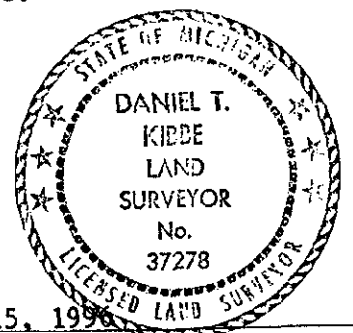

Signed by *Daniel T. Kibbe*
Surveyor's Michigan License No. 37278

Date October 15, 1996