

JAN 21 2000

1999 ALPENA COUNTY REMONUMENTATION CORNER

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Alpena
(County)


Located in:

Corner Code #



L-2 P-235
11/22/1999 01:43P
Page: 1 of 1
Kathy J. Natash, Register Alpena Co., MI LDC 9.00

- 1. Public Land Survey T29N R8E D-11
T R Sanborn Twp.
- 2. Property Controlling in Section S T R
- 3. Miscellaneous S T R
- Property in Sec. S T R

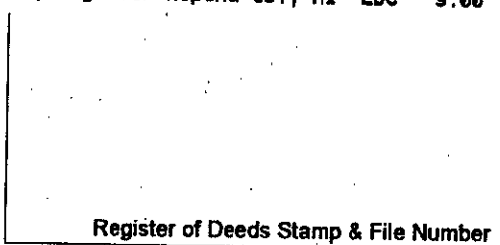

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

I, Thomas L. Fabis, in a field survey on July 27, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

- A. Description of original monument and accessories and/or subsequent restoration:
1839: G.L.O. Survey Lewis Clason set post & referenced: Cedar 12 S8E 25, Do 6 N55W 28.
1905: County Survey Jos. W. McNeil set stake 50 lks. North of corner.
1998: Alpha Land Survey Co. David Guthrie found 3/4" iron pipe & referenced.


- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
1999: Found 1 1/4" Hex. Bolt in corner position and found 4 witnesses with orange tags P.S. #22435 confirming that this is the same corner position used by Guthrie.

The position of this corner is compatible with county and local surveys and is accepted as a careful and faithful perpetuation of the position of the original corner.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
1999: Replaced 1 1/4" Hex. Bolt with 1/2" iron rod with 3" dia. alum. cap, stamped to identify the corner. Witnesses are:
Tag #22435 in Fe. Post N45W 41.57
Tag #22435 in Cor. Fe. Post N2W 29.81
Set tag #31591 in New Post S48W 44.00
Set tag #31591 in New Cor. Post S4W 33.86

P.A. 345 ALPENA COUNTY
PEER APPROVED 8/26/99
D.P.B. [Signature]

Signed by Thomas L. Fabis
Surveyor's Michigan License No. 31591

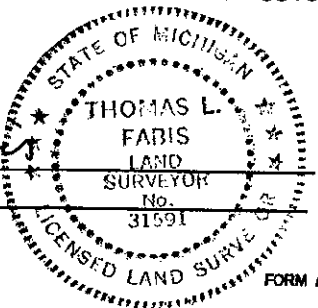

Date November 19, 1999