## NOV 1 6 1998

P.A. 345 ALPENA COUNTY
1998 ALPENA COUNTY REMONUMENTATION CORNER
PEER APPROVED 8/10/91
SECTION
LAND CORNER RECORDATION CERTIFICATE

\_ , Recorded Plat


4. Lot No. 5. Private Claims

SECTION LAND CORNER RECORDATION CERTIFICATE

For corners in	Filing Requ	ulrement of Act 74, Mich. P.A. :	Liber UUUUZ Page U152 STATE OF MICHIGAN
Alpena (County)	Located In: C	orner Code #	County of Alsena Recorded
1. Public Land Survey	T <u>32NR 7E</u> TR TR	I-2 Maple Ridge Twp.	08-20-1998 09:19:27 Kathy J. Matash REGISTER OF DEEDS
Property Controlling     in Section     Miscellaneous	TR S TR S TR S TR		
Property in Sec.	S_ T_R_		Register of Deeds Stamp & File Number

I, <u>Thomas L. Fabis</u>, in a field survey on <u>Feb. 19</u>, 19 <u>98</u> do hereby state that under requirements of P.A. 74. Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and Jor that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

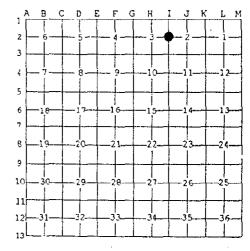

- A. Description of original monument and accessories and/or subsequent restoration:
- 1857: G.L.O. Survey Josiah Knauer Set post & referenced: Cedar 12 N67E 20, Cedar 18 S82W 11:
- 1893: County Survey Fred Rice - Found witness trees standing.
- Survey Liber 1 Page 988 & 989 Earl Lewis Set 1/2" Rod & referenced. 1981:
- 1982: L.C.R.C. Liber 1 Page 155 Ron Bischer - Found 1/2" Rod & referenced.
- 1990: Survey W.O.4-1039 Earl Lewis - Found 1/2" Rod & referenced.
- Mortgage Inspection W.O.4-8499 R.S.Scott Associates, Inc. Found 1/2" Rod. 1992:
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.
  - Found 1/2" iron rod 4 feet West of centerline of Cathro Rd. (gravel surface) Intersecting fences East & West. Also, found 2 witness objects by Ron Bischer and 2 witness objects by Earl Lewis, indicating that this is the same corner that they used.

The position of this corner is compatible with county and local surveys and is accepted as a careful and faithful perpetuation of the position of the original corner.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- Set 3" dia. aluminum cap, stamped to identify the corner, over the existing 1/2" iron rod. 1998:

Reestablished witnesses are:

Set tag #31591 in the following witness objects: Power Pole N25E 59.27

Apple N80E 39.72 7" Cedar East 57.00' Fence Post West 27.02'

Surveyor's Michigan License No.

Date August 14, 1998

STATE OF MICHIGAN \* FABIS

\* FABIS

\* LAND

\* SURVEYOR

NO

31591

CAND

\* SURVEYOR

AND

\* SURVEYOR

\* SURV

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14,1975 REVISED JAN., 1963 REVISED OCT., 1995