

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Dec 16 10 19 AM '93

For corners in

Alpena (County)

Located In:

Corner Code #

- 1. Public Land Survey T 32N R 8E H - 9
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R
4. Lot No. , Recorded Plat
5. Private Claims

REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Duane R. MacNeill, in a field survey on July 30, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Grid table with columns A-K and rows 2-13. A dot is present at the intersection of column H and row 9.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1855 - Cedar Post

Witnesses:

- Tamarack 7 N 21 W 20
Cedar 12 S 39 W 6

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original monument or accessories remains. In 1973 a 4"x4" cedar stake was found, accepted as H-9 and recorded, no witnesses were recorded. In 1977, the 4"x4" stake was again found and a 1" pipe was set in the interest of permanence. Witnesses recorded as follows:

- S 05° W 4.57' 5" Cedar
N 75° W 4.36' 3" Cedar
N 60° E 15.45' 4" Cedar

All above evidence was found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


1/2" rerod driven inside found 1" pipe and capped with Alpena County Remonumentation Aluminum Cap, - stamped appropriately.

Witnesses:

- S 22° W 4.94' 8" Cedar (twin) Fd.
N 52° W 4.03' 6" Cedar Fd.
N 70° E 15.49' 6" Cedar Fd.
N 04° E 20.33' 6" Cedar Set

Witnesses were freshened as necessary and nails replaced with duplex nails bearing brass washers stamped #19237

Signed by Duane R. MacNeill
Surveyor's Michigan License No. 19237

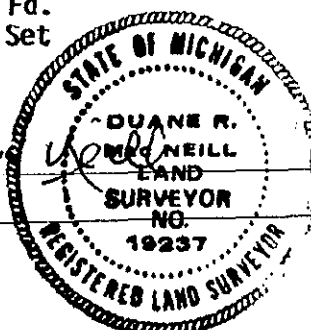

Date December 6, 1993