

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 30 N. R. 6 W.	A-5; A-6
2. PROPERTY CONTROLLING IN SECTION 8	T. 30 N. R. 6 W.	8; 9
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 2, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and of subsequent restoration:~~

C. (continued)

9

Found 1" pipe in road (1" pipe is 33.0' N)
 16" B. Cherry N40°E 50.10
 9" B. Cherry N38°W 50.10
 9" Maple S20°E 29.29
 Set cedar post w/loc. tag Due N 33'
 Center E-W dirt county rd. Due N 6'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 5 Accepted old corner fence post with crockery, fence N-S-E-W, as section corner.
- 6 Recovered old 1"x36" tapered tube, possible shotgun barrel, in line with center of road west and 4' east of center of road north.
- 8 Found & accepted 1" pipe as recovered and accepted by RLS Bob Findorff in 1967; Corner believed to be a result of old Botsford survey.
- 9 Found & accepted 1" pipe as recovered and accepted by RLS Bob Findorff in 1967; corner believed to be a result of old Botsford survey.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-5	A-6	8
Set DNR mon. & cedar post	Set 1½"x36" pipe w/ shotgun barrel in top	Found 1" pipe in road
11" Maple N09°W 38.1	9" B. Cherry N32°E 56.27	10" B. Cherry N74°W 80.05
14" Maple S58°W 7.7	16" R. Pine N22°E 109.65	6" Apple (cluster of 8) N66°E 81.45
14" Maple S12°W 48.8	18" W. Pine S09°E 131.77	Power Pole S66°E 64.12
9" Maple N40°E 55.2		Center B'top M-66 Due W 28.5
		Set cedar post w/loc. tag Due N 33.0

SIGNED BY Carl F. Roser 9-15-76 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

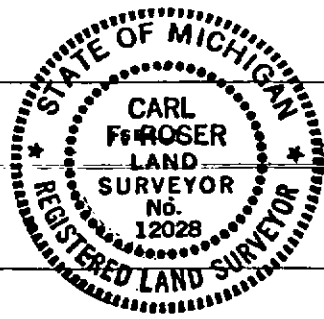

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ CHESTONIA TOWNSHIP
 ANTRIM COUNTY