

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>30</u> N. R. <u>7</u> W. ●	K-1; K-3; J-1
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October 29, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

K-1 Continued - and at pro-rated dist. to 1855 U.S. tie West to SW Cor. of Sec. 36, T31N, R7W, of 37.13 chains (2450.6'), said pro-ration being per comparison to W. 1/2 mile of N. Line of Sec. 2, T30N-R7W (- 5'± from U.S.). The S 1/4 Cor., Sec. 36, T31N-R7W, is S86°18'E, 244.64'.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- K-1** Reestablished section corner common to Sec. 1 & 2, T30N-R7W, on third correction line, on line between the SE & SW corners of Sec. 36, T31N-R7W, (See above)
- K-3** Accepted old fence corner, fence remains E-W-N for Section corner common to sec. 1-2-11-12, T30N-R7W. Fence corner fits US stream tie to W reasonable and Church prorated distance W 1 mile on N line of Sec. 11, good. Corner also fits US distance 1 mile E & W, prorated, excellent.
- J-1** Reestablished N 1/4 corner Sec. 2, on third correction line, on line between the SE & S 1/4 corners of Sec. 35, T31N-R7W & equidistant between the NE & NW corners of Sec. 2. The corner on third correction line common to Sec. 35 & 36 (T31N-R7W) is S87°40'E, 197.07'.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-1	K-3	J-1
Set DNR mon. & cedar post	Set DNR mon. & cedar post	Set DNR mon. & cedar post
7" Cedar N44°E 20.9	8" Ironwood S75°E 44.7	16" Cedar S45°W 6.5
7" Cedar S40°E 23.1	7" Ironwood S27°E 38.0	12" Cedar N33°W 33.3
6" Cedar S06°E 19.0	10" Maple N37°E 83.4	10" Cedar N45°E 38.6
6" Cedar S80°W 27.2	10" Maple S89°W 44.8	6" Cedar N78°E 248
E-W Random Due N 78.1		E-W Random Due N 123'

SIGNED BY Carl F. Roser 9-15-76 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

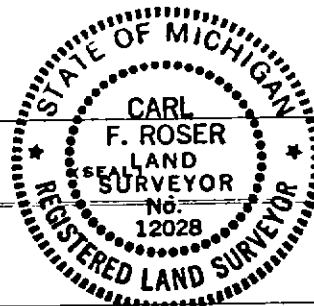

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ KEARNEY TOWNSHIP
ANTRIM COUNTY