

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 31 N. R. 6 W. ●	E-9; F-9
2. PROPERTY CONTROLL- 29 ING IN SECTION _____	T. 31 N. R. 6 W. ●	7
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. R. _____ E. S. R. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 2, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- E-9 Restored corner in center of E-W blacktop road at distance E of center of M-66 as shown on Antrim Co. Road Comm. plans, Fed. project S616(3), State project CS5-38, sheet #4, dated 1956.
- F-9 Found old 1 1/4" pipe by old corner fence post, fence N-S-E-W. Corner seems to fit old survey of Sec. 21 by B.L. Caukin, Co. Survey, Rec. #1, page 246, August 1905.
- 7 Established 1/16 corner equidistant and on line between section corner N and 1/4 corner S.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-9	F-9	7
Drove 1-1/8"x18" iron rod in blacktop road	Found 1 1/4" pipe	Set 1"x36" pipe & cedar post w/loc. tag
14" Hemlock N35°W 74.80	16" Tamarack S12°W 72.72	20" W. Pine N40°E 13.9
16" W. Pine S14°W 53.89	9" Tamarack S58°W 30.85	16" W. Pine N66°W 40.8
9" Hemlock S45°W 66.31	7" W. Pine N71°W 28.30	14" W. Pine S76°W 50.7
Set cedar post w/loc. tag	Corner Fence Post w/loc. tag	6" Maple S19°E 23.0
Due S 33'	N60°E 2'	
Random S Due W 38.8'	Center old Rd. Grades	
	Due E 10'	

SIGNED BY Carl F. Roser 9-15-76 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

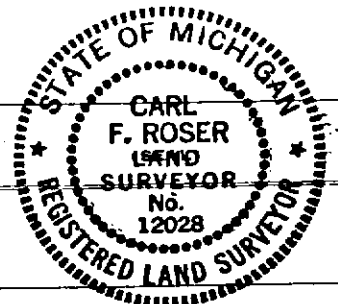

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ JORDAN TOWNSHIP
ANTRIM COUNTY

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET