

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>31</u> N. R. <u>6</u> W.	C-11; D-11; E-11
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on December 18, 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-11 Found point of stake from U.S.B.T. (stump) white pine N80°E, 9.2' and remains of tamarack stump S83°W, 4'. Good original U.S. corner.
- D-11 Found 1 1/4" pipe in place as noted on M.S.H.D. M-66 plans dated 1935. One stump remains of witness. The same data appears on page 43 of old large county surveyor's book at County Road Commission (no date).
- E-11 Restored section corner by old corner fence post, fence remains S and E. Fence corner fits U.S. distance N-S-W to found corners very reasonable and also U.S. swp. tie to N.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-11	D-11	E-11
Set DNR mon. & cedar post	Found pipe & added DNR mon. and cedar post	Set DNR mon. & cedar post
8" W. Pine S72°W 32.1	10" Twn. Maple N64°E 51.8	5" Maple N38°W 12.9
9" W. Pine N28°W 34.1	10" Maple S62°E 63.4	7" Cherry S40°W 36.5
7" Cedar N66°E 32.8	9" B. Cherry S32°W 53.3	6" Maple N51°E 21.2
10" W. Pine S03°W 47.0	15" B. Cherry N78°W 74.1	


SIGNED BY Carl F. Roser 9-15-76 DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

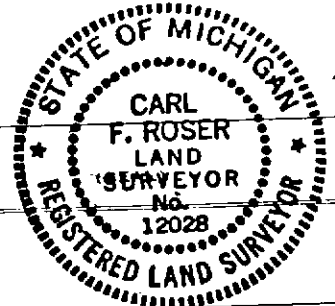

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

JORDAN TOWNSHIP  
ANTRIM COUNTY

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 26, 1971  
REVISED MAY 14, 1976

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET