

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>31</u> N. <u>●</u> R. <u>6</u> W. <u>●</u>	B-13; C-13; E-10
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on December 18, 19 74, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- B-13 Reestablished 1/4 corner on line 6 at G.L.O. distance between SE & SW corners of Sec. 31. The corner common to Sec. 6 T30N-R6W & Sec. 1 T30N-R7W is S89°16'E, 127.28'.
- C-13 Reestablished corner common to Sec's 31 & 32 T31N-R6W on third correction line, at G.L.O. distance between SW Sec. 31 and SE Sec. 32 and at record G.L.O. deflection angle (7 min.) on third correction line. NOTE: G.L.O. resurvey of T31N-R6W included the resurvey of the third correction line. The N 1/4 corner of Sec. 6 T30N-R6W is S89°23'E, 358.66'.
- E-10 Reestablished 1/4 corner equidistant and on line between section corner to N and S.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-13	C-13	E-10
Set DNR mon. & cedar post	Set DNR mon. & cedar post	Set DNR mon. & Cedar post
6" Maple N83°E 27.2	9" W. Pine S19°W 57.6	9" B. Cherry N34°W 65.8
6" Maple S46°E 26.3	8" Maple S57°W 50.0	16" B. Cherry S41°E 52.6
6" Maple S64°W 13.1	12" W. Pine N55°W 35.2	7" Tri-B.Cherry N71°E 39.6
8" Maple N17°W 11.0	10" W. Pine N44°E 42.4	
E-W random Due S 90	E-W Random Due S 57	

SIGNED BY Carl F. Roser 9-15-76 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

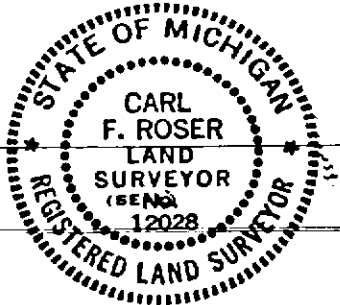

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ JORDAN TOWNSHIP
 ANTRIM COUNTY