

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. <u>31</u> N. <u>7</u> W. ●		<u>K-11; K-13; L-13</u>
2. PROPERTY CONTROLLING IN SECTION _____ T. _____ N. S., R. _____ E. W.		_____
3. MISCELLANEOUS PROPERTY IN SECTION _____ T. _____ N. S., R. _____ E. W.		_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, \_\_\_\_\_, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 11 Restored corner per F.Church survey of record Sec. 25 & 35 1887 & 1888; Church notes in large volume 1 of co. survey records, pps, 17-22 & 68-71, at Antrim Co. Reg. of Deeds.
- 13 REstored corner per Church survey of record of Sec. 35, 1887 & 1888; including Church tie to stream crossing to west of 601'; notes in large Vol. 1 of Co. Surveyor's records, pps 17-22 & 70-71 at Antrim Co. Reg. of Deeds. The N ¼ corner of Sec. 2 T30N-R7W (on third correction line) is N87°40'W, 197.07'.
- 13 Reestablished S¼ corner, Sec. 36 (on third correction line) equidistant & on line between the SE & SW corners of Sec. 36. The corner on third correction line common to Sec. 1 & 2 T30N-R7W is N86°18'W, 244.64'.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-11	K-13	L-13
Set std. DNR mon. & ced. post	Set DNR mon. & cedar post	Set DNR mon. & cedar post
8" Maple N05°W 2.9	14" Cedar S22°W 14.7	6" Cedar N48°E 27.7
6" Maple S32°W 10.1	24" W. Pine stump	8" Cedar S34°E 7.2
6" Maple N77°W 28.2	S63°W 7.8	4" Cedar S51°W 30.8
Random South Due W 2.3	9" Cedar N77°W 30.8	4" Cedar N45°W 25.0
	8" Cedar N20°E 37.5	E-W Random Due N 72.5
	Random North Due E 13.9	
	E-W random Due N 124.5	

SIGNED BY Carl F. Roser 9-15-76 DATE

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

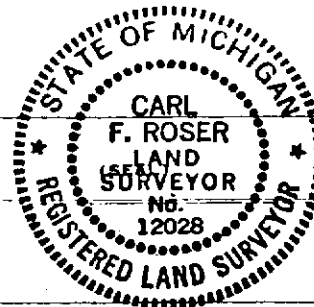

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

ECHO TOWNSHIP  
ANTRIM COUNTY