

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>31</u> ^{N.} <u>7</u> ^{W.}	<u>I-11; J-11; H13</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____, S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____, S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October 27, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 11 Recovered NW corner of Sec. 35, T31N-R7W. Found pointed cedar stake bottom in water bearing sand, below muck in swamp, & remains of U.S.B.T. cedar stump S13½°W 18.5. Corner fits Church survey of Sec. 35 dated 1887 & 1888.
- 11 Found light wagon axle as shown by local landowner. Corner fits F.S.Church survey of Sec. 35, dated 1887 & 1888.
- 13 Reestablished S¼ corner Sec. 34, T31N-R7W on third correction line, on line between the NW & NE corners of Sec. 3, T30N-R7W & at record U.S. distance E of NW corner, Sec. 3. The NW corner of Sec. 3, T30N-R7W is N87°55'W, 244.20.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-11	J-11	H-13
Fd. stake bottom & set DNR Monument & cedar post	Found light wagon axle & set cedar post w/loc. tag	Set DNR mon. & cedar post
6" Cedar N57°E 16.3	14" Maple S74°E 23.3	9" Maple S30°E 8.6
10" Cedar S50°E 34.2	12" Maple N37°E 37.7	8" Maple S47°W 32.7
9" Cedar S25°E 17.4	9" Maple N26°W 32.2	7" Maple N58°W 20.7
7" Cedar S77°W 26.6	8" Maple S77°W 33.1	12" Maple N70°W 27.0
N-S Random Due E 21.5		Set 1'x1½'x2' quartz rock on end S45°E 1 ft.


SIGNED BY Carl F. Roser 9-15-76 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

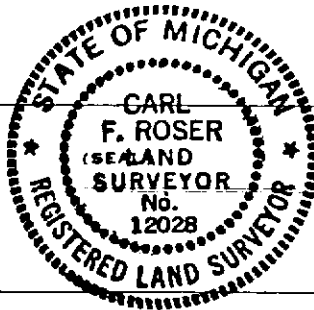

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

ECHO TOWNSHIP
ANTRIM COUNTY