SURVEY & REMONUMENTATION

FEB 11 1998

Liber 00002 Page 0423

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in CENTRAL LAKE TWP.

ANTRIM (County)

Located In: Corner Code #

1. Public Land Surveys S¼ S 22 T31N R 8W H-9
   T___ R___
   T___ R___
   T___ R___
2. Property Controlling in Section S___ T___ R___
   S___ T___ R___
3. Miscellaneous Property in Sec. S___ T___ R___
   S___ T___ R___

ANTRIM COUNTY MI.
Register of Deeds
Recorded

12-15-1997 08:51:27

Wanda R. Conway
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

133

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

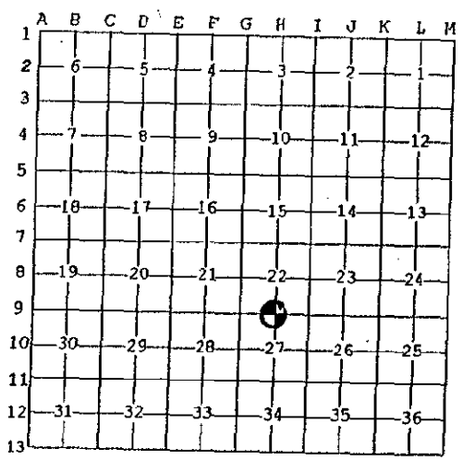

I, NEIL L. WAY, in a field survey on 19 NOV. 19 97 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO SET B. ASH POST APRIL 1857, SUGAR 14 N67E 44, BEECH 11 S26 3/4W 21

CHURCH (CO. SURVEYOR) APRIL 1911, A STAKE BY W. SIDE OF A FENCE POST

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1/2" IRON RE-ROD AND CAP (B. JONES #23514) AND WITNESSES, 0.1' BELOW GRADE, IN CENTERLINE OF A NE'LY-SW'LY 2-TRACK, 10' WEST OF A DOWNED NORTH-SOUTH FENCE AND 3' NORTH OF A DOWNED EAST-WEST FENCE, FOUND BOAT SPIKE 0.1' NORTHWEST OF FOUND IRON

B. JONES SEP. 1991 (L. 367 P. 667) FOUND 1/2" IRON
S12W 6" MAPLE 29.70'
N67W 8" MAPLE 26.00'
N53E 8" MAPLE 29.95'
N42W 8" BASS 5.30'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET ANTRIM COUNTY MONUMENT, 0.5' BELOW GRADE

S10W 29.59' SET NAIL W/SIDE 6" MAPLE
N43W 5.26' FOUND NAIL SW/ SIDE 10" MAPLE
N37E 29.98' SET NAIL SE/SIDE 8" MAPLE
S78E 11.59' SET NAIL N/SIDE 14" MAPLE

Ratified by Peer Group in accordance with P.A. 345
Antrim Co. Chairman
Arthur L. Lennox
Nov. 18, 1997

STATE OF MICHIGAN
NEIL L. WAY
LAND SURVEYOR
NO. 28432
LICENSED LAND SURVEYOR

Signed by _____

Surveyor's Michigan License No. 28432

Date 24 NOV. 1997

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995