

Arenac County Remonumentation

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

LIBER **02** PAGE **62**
 JAN 2 2 46 PM '95
 ARENAC COUNTY REGISTER OF DEEDS
 RECORDED

For corners in <u>Arenac</u> <small>(County)</small>	Located In:	Corner Code #
1. Public Land Survey	T <u>18N</u> R <u>4E</u>	<u>B 9</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K
2	6	5	4	3	2	1				
3										
4	7	8	9	10	11					
5										
6	18	17	16	15	14					
7										
8	19	20	21	22	23					
9										
10	30	29	28	27	26					
11										
12	31	32	33	34	35					
13										

I, Craig W. McVean, in a field survey on May 26, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- B 9 - Set 1/4 Section post - J. Burt - 1843.
Maple 9" N 22° W 25 Lks.
- B. Ash 12" S 32° W 13 Lks.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

B 9 - Found PS cap 21575 on 1/2" x 18" rebar in centerline of E-W Road in line with fence line N - remove rebar and find 3/4" inner diameter iron pipe - down 1.7'. Dig down 2.0' and find remains of wood on S, W and N side of pipe. Leave pipe and wood in place and drive 3" Arenac County brass cap 5/8" x 24" rebar inside pipe - down 0.5'. Place 4" plastic tile sleeve with concrete and ring of granite cobble stones around brass cap. Monument accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- B 9 - 3" Arenac County brass cap on 5/8" x 24" rebar with 4" tile sleeve with concrete.
- N 09° E 43.13' to nail and tag in E side wood anchor post.
- N 45° E 118.64' to nail and tag in W side 4" Ash.
- N 67° E 182.64' to nail and tag in SE side 18" Maple.
- S 25° E 22.70' to nail and tag in S end 18" CMP.
- N 44° W 45.23' to nail and tag in W end 36" CMP.

ACCEPTED BY THIS ARENAC COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON 22 NOV. 1995
Paul M. Ginder
 PAUL M. GINDER P.E., CHAIRMAN

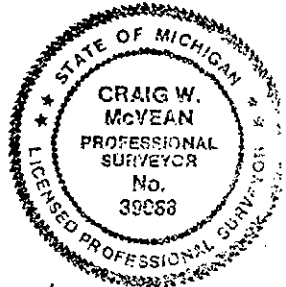

Signed by Craig W. McVean Date 12/20/95
 Surveyor's Michigan License No. 39088

B. 2 2 1996
 MISSIVE