

LAND CORNER RECORDATION CERTIFICATE

* Filing Requirement of Act 74, Mich. PA 1970

For Corners In: <u>Arenac</u> (County)	Located In	Corner Code #
1. Public Land Survey	T <u>20N</u> R <u>3E</u> <u>E13</u>	
	T <u>19N</u> R <u>3E</u> <u>E1</u>	
2. Property Controlling in Section	S _____ T _____ R _____	
	S _____ T _____ R _____	
3. Miscellaneous Property in Section	S _____ T _____ R _____	
	S _____ T _____ R _____	


Register of Deeds Stamp & File Number

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

I, Craig W. McVean, in a field survey on Aug. 10, 2004 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

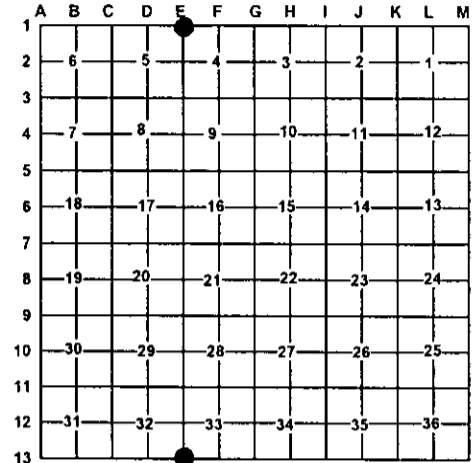

A. Description of original monument and accessories and/or subsequent restoration:

- E1 & E13 – GLO – Set Post – L. Clason – 1837
 Pine 4" N31°E 25 L.
 Pine 4" S74°W 20 L.
 - GLO Sub. – T19N, R3E – John Mullett - 1846
 Inter. Twp. Line at post corner Sec. 32 & 33 –
 Set post at intersection.
 W. Pine 8" S80°W 20 L.
 W. Pine 6" S15°E 41 L.
 - MDOT Wit. Card – C. F. Roser – 1964
 (LCRC L. 1, p. 233 – 1984)
 Fd. 2" pipe used to control the setting of corners

to the East on Twp. Line. This corner is also shown as a 3" pipe on "Rayburn" oil well site prints obtained from S. Ernest Lucas, (RLS #4747) Mio, MI 12" Twin Birch S18°W 104.37'; 9" Wild Cherry S80°W 117.99'; 8" Oak N53°W 112.55'; 7" Birch N35°E 75.12'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

E1 & E13 – Standard Corner common to Sec. 32 & 33, T20N, R3E and Sec. 4 & 5, T19N, R3E – Fd. 2" iron pipe – Top 2.5' rust off at ground per MDOT. Measured East 655± 10' (660' – GLO) to edge of swamp WSW – ENE. No GLO evidence found. 2" iron pipe accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E1 & E13 – Drove stamped 2 1/2" Alum. Cap on 5/8" x 34" iron rebar into centerline of Fd. 2" pipe
 Set Blue Carsonite Post 1' NW. Set Brown Carsonite Post 1' E
 S78°W 117.82' to set N & T in N. side 13" Cherry (MDOT)
 N57°W 112.50' to set N & T in NE side 14" Oak scribed 'XBT' (MDOT)
 N21°W 24.72' to set N & T in W. side 3" R. Maple scribed 'XBT'
 S7°W 38.40' to set N & T in W. side 9" Tamarack scribed 'XBT'
 N84°E 24.42' to set N & T in S. side 5" Tamarack



Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 2/7/2005