

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

	BARAGA COUNTY		
FOR CORNERS OF--:	LOCATED IN--:		CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 47	N. R. 33	E. W.
2. PROPERTY CONTROLLING IN SECTION _____	T. _____	N. S., R. _____	E. W.
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____	N. S., R. _____	E. W.
4. LOT NO. _____, RECORDED PLAT _____			
5. PRIVATE CLAIMS _____			

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Keith L. Sackett, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on See Below, 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- Corner E12: Found 1" iron pipe with 4" brass cap set from two original bearing trees.
  - Corner E10: Original monument and accessories not found.
  - Corner G10: Original monument and accessories not found.

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- Corner E12: Restored 3-9-81 at monument.
  - Corner E10: Restored 3-11-81 midway and on line between section corners north and south.
  - Corner G10: Restored 3-10-81 midway and on line between section corners north and south.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- Corner E12: 1" iron pipe with 4" alum. cap.
    - 7" Sugar N35W 26.8 ft. 1/2S,NBT
    - 12" Sugar N20E 27.8 ft. 1/2S,NBT
    - 13" Sugar S32E 14.1 ft. 1/2S,NBT
  - Corner E10: Set 1" I.D.x32" iron pipe with 4" alum. cap.
    - 7" Tamarack S59E 21.0 ft. 1/2S,NBT
    - 8" Tamarack N75W 61.9 ft. 1/2S,NBT
  - Corner G10: Set 1" I.D.x32" iron pipe with 4" alum. cap.
    - 8" Spruce N86E 22.8 ft. 1/2S,NBT
    - 8" Spruce S14E 11.5 ft. 1/2S,NBT
    - 7" Spruce N76W 6.5 ft. 1/2S,NBT
    - 8" Spruce squared N13W 4.7 ft. marked 1/2S, 28/27

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_


(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Keith L. Sackett DATE 10-22-81

CHIEF OF SURVEY PARTY  
MICHIGAN REGISTERED LAND SURVEYOR  
**Keith L. Sackett**  
Department of Natural Resources

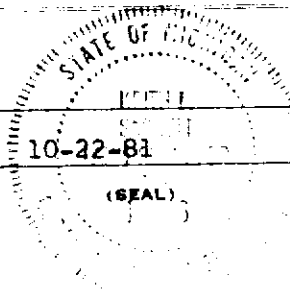

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. 19006