

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>50</u> N. <u>34</u> R. <u>34</u> ^{EX} _W	<u>D7 & E6</u>
2. PROPERTY CONTROLLING IN SECTION_____	, T. _____ N. _____ S., R. _____ E. _____ W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION_____	, T. _____ N. _____ S., R. _____ E. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 28, 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior. Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
Corner D7: 1/4 corner between Sections 17 & 20, T50N, R34W.
 W. Pine post (Not found. No subsequent monuments found.)
 Y. Pine 8 S 5E 12 (Found. No subsequent accessories found.)
 Sugar 6 N38E 10 (Not found. No subsequent accessories found.)

Corner E6: 1/4 corner between Sections 16 & 17, T50N, R34W:
 W. Pine post (Not found. No subsequent monument found.)
 Maple 5 N65°E 13 (Not found. No subsequent accessories found.)
 Y. Pine 30 S75°W 15 (Found. No subsequent accessories found.)

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
Corner D7: Placed a new monument at record bearing and distance from the found original BT, identified from old axe notch on lower blaze and by position in relation to Sec. Corners 39.901 ch. E and 39.905 ch. W and to 2 original line trees, one 18.75 ch. E and the other 29.075 ch. E.

Corner E6: Placed a new monument at record bearing and distance from the found original BT, identified by trace of axe notch and overgrowth scar tissue of lower witness blaze. Corner lies 9.963 ch. N of an original line tree, the record distance being 9.96 ch.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Corner D7: 1" I.D. x 36" iron pipe with 3 1/2" aluminum cap.
 Red Pine 7 N84°W (mag.) 38.6 ft. "1/4S, NBT"
 Red Oak 7 S49°W (mag.) 42.7 ft. "1/4S, NBT"

Corner E6: 1" I.D. x 36" iron pipe with 3 1/2" aluminum cap.
 Red Maple 6 N 1°E (mag.) 22.6 ft. "1/4S, NBT"
 Red Maple 4 S12°W (mag.) 36.7 ft. "1/4S, NBT"

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE October 28, 1976

CHIEF OF SURVEY PARTY
Arthur O. Enger
 MICHIGAN REGISTERED LAND SURVEYOR
 Arthur O. Enger

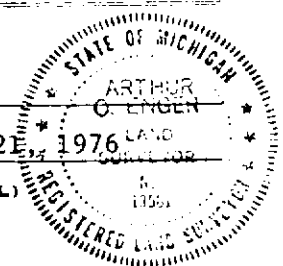

Michigan Department of Natural Resources
 13581

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581